

Non-Spoiler Trunk Lid Not Holding Open on Extreme Inclines

Service Category Vehicle Exterior

Section Door/Hatch

Market USA

Toyota Supports
 ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2012 – 2014	Camry HV	Body Type(s): 4Dr. Sedan Drive Type(s): 2WD Engine(s): 2AR Transmission(s): CVT VDS(s): BD1FK
2012 – 2014	Camry	Body Type(s): 4Dr. Sedan Drive Type(s): 2WD Engine(s): 2AR, 2GR Transmission(s): 6AT VDS(s): BF1FK, BK1FK

Introduction

Some 2012 – 2014 model year North American Production (NAP) Camry and Camry HV vehicles without a factory installed spoiler may exhibit a condition where the holding performance of the trunk lid is unsatisfactory when the vehicle is on an extreme incline. Use the following bulletin to address this condition.

Warranty Information

OP CODE	DESCRIPTION	TIME	OPF	T1	T2
BD1401	R & R Torsion Bar (Both Sides)	1.0	64532-06212 64531-06192	9A	14

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Non-Spoiler Trunk Lid Not Holding Open on Extreme Inclines

Production Change Information

This bulletin applies to:

- ALL 2012 – 2013 model year TMMK and SIA built vehicles without a factory installed spoiler.
- 2014 model year TMMK and SIA built vehicles produced **BEFORE** the Production Change Effective VINs shown below and without a factory installed spoiler.

MODEL	PLANT	LINE*	ENGINE	PRODUCTION CHANGE EFFECTIVE VIN
Camry	TMMK	1	4 Cyl	4T1BF1FK#EU331864
		2		4T1BF1FK#EU753784
		1	V6	4T1BK1FK#EU024782
		2		4T1BK1FK#EU541822
Camry HV			HV	4T1BD1FK#EU103805
Camry	SIA	N/A	4 Cyl	4T4BF1FK#CR269427

* For Camry, TMMK Line 1, first digit of serial number = 0, 1, 2, 3 or 4 and for Line 2, first digit of serial number = 5, 6, 7, 8 or 9.

Parts Information

PART NUMBER		PART NAME	QTY
PREVIOUS	NEW		
64531-06192	64531-06193	Bar, Hinge Torsion, RH	1
64532-06212	64532-06213	Bar, Hinge Torsion, LH	1

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Luggage Compartment Tool Set*	09804-24010	1

* Essential SST.

NOTE
Additional SSTs may be ordered by calling 1-800-933-8335.

Non-Spoiler Trunk Lid Not Holding Open on Extreme Inclines

Repair Procedure

1. Remove both Hinge Torsion Bars.

NOTE

Both Hinge Torsion Bars MUST be replaced during repair.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

- 2012 [Camry](#) / [Camry HV](#):
Vehicle Exterior – Door/Hatch – “Luggage Door Hinge Torsion Bar: Removal”
- 2013 [Camry](#) / [Camry HV](#):
Vehicle Exterior – Door/Hatch – “Luggage Door Hinge Torsion Bar: Removal”
- 2014 [Camry](#) / [Camry HV](#):
Vehicle Exterior – Door/Hatch – “Luggage Door Hinge Torsion Bar: Removal”

2. Install the NEW Hinge Torsion Bars.

Refer to TIS, applicable model and model year Repair Manual:

- 2012 [Camry](#) / [Camry HV](#):
Vehicle Exterior – Door/Hatch – “Luggage Door Hinge Torsion Bar: Installation”
- 2013 [Camry](#) / [Camry HV](#):
Vehicle Exterior – Door/Hatch – “Luggage Door Hinge Torsion Bar: Installation”
- 2014 [Camry](#) / [Camry HV](#):
Vehicle Exterior – Door/Hatch – “Luggage Door Hinge Torsion Bar: Installation”

3. Open and close the trunk to confirm proper operation.