

Subject

Mark:

Best practices when performing TSIB L-SB-0008-12

USA

Service Category

Brake

Section

Brake (front)

Applicability

2010-2014 LS460 FSPORT

APPLICABLE VEHICLES

2010-2014

LS460


CONDITION

Customers experience a brake squeak noise from the front brakes when the brakes are cold and the vehicle is operated at slow speeds. TSIB L-SB-0008-12 was issued for this condition. This document provides reminders when performing L-SB-0008-12.

RECOMMENDATIONS

We recommend the following tasks when performing the repair.

1. Do not polish and/or grind the brake disc.
Also, do not replace the brake disc unless the disc thickness is less than 33.0 mm (1.30 in.).
2. Grease is included with the front disc brake pad kit. Apply a light coat of disc brake grease to the edges of the brake pads as shown in the illustration. And, ensure there is no oil and/or grease on the friction surfaces of the pads and the disc.
3. Make sure the single slotted pad is installed on the inside location of the brake disc.

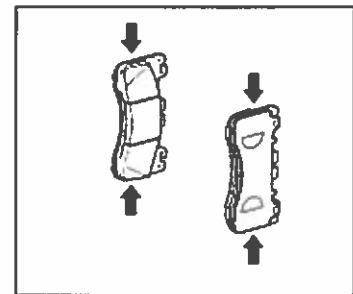

Application point of grease

LINK REFERENCES

This Tech Tip does not contain any link references