

Subject

**Best practices when performing TSIB L-SB-0008-12**

Market

USA

Service Category

Brake

Section

Brake (front)

Applicability

2010-2014 LS460 FSPORT

**APPLICABLE VEHICLES**

2010-2014

LS460


**CONDITION**

Customers experience a brake squeak noise from the front brakes when the brakes are cold and the vehicle is operated at slow speeds. TSIB L-SB-0008-12 was issued for this condition. This document provides reminders when performing L-SB-0008-12.

**RECOMMENDATIONS**

We recommend the following tasks when performing the repair.

1. Do NOT polish and/or grind the brake disc.  
Also, do not replace the brake disc unless the disc thickness is less than 33.0 mm (1.30 in.).
2. Grease is included with the front disc brake pad kit. Apply a light coat of disc brake grease to the edges of the brake pads as shown in the illustration. Additionally, ensure there is no oil and/or grease on the friction surfaces of the pads and the disc.
3. Make sure the single slotted pad is installed on the inside location of the brake disc.
4. Perform all repairs following the TSIB L-SB-0008-12 or repair manual. Disregard the replacement instructions that are included with the front disc brake pad kit by the brake pad kit supplier.

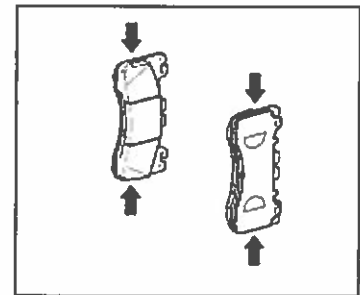

Application point of grease

**LINK REFERENCES**

This Tech Tip does not contain any link references