



# Service Bulletin

File in Section: -

Bulletin No.: PI0924B

Date: May, 2014

## PRELIMINARY INFORMATION

**Subject:** Intermittent Unwanted Trunk Opening While Vehicle is Parked

**Models:** 2010-2014 Buick LaCrosse  
2011-2014 Buick Regal  
2012-2014 Buick Verano  
2011-2013 Chevrolet Cruze  
2012-2013 Chevrolet Sonic (4 Door Sedan Only)  
2013-2014 Chevrolet Malibu

This PI has been revised to remove the 2014 model year for the Cruze and Sonic. Please discard PI0924A.

### Condition/Concern

Some customers may comment on unwanted opening of the trunk without pressing any of the release buttons while the vehicle is parked. Although the trunk is unlatched while parked, the owner may not observe the trunk open until they begin to drive the vehicle. This may also be accompanied with a "Trunk Open" message in the DIC.

This condition may be caused by the trunk release button on the remote transmitter being pressed inadvertently while the transmitter is in their pocket or purse.

### Recommendation/Instructions

Replace the KR95B Rear Compartment Lid Unlatch Relay with a "Two Shot Relay", GM P/N 19119267, using the applicable procedure below. When installed, the remote transmitter (key fob) trunk release button, the exterior rear compartment lid release switch (touch pad) or the interior rear compartment lid release switch must be pressed twice within three seconds to release the trunk.


#### **For LaCrosse, Regal (2011 Germany Built (RPO RUE)), Verano, Cruze and Malibu**

Remove the KR95B Rear Compartment Lid Unlatch Relay located in the X51A Instrument Panel Fuse Block and install the "Two Shot Relay."


#### **For Regal (2011 Oshawa Built (RPO OSH), 2012-2014) and Sonic**

The rear compartment lid unlatch relay is part of the printed circuit board in the relay/fuse block and not serviceable separately. Installation of an external relay circuit to bypass the feed to the trunk release control will be required. Install the "Two Shot Relay" adjacent to the BCM and attach a tag to the relay and mark with "Two Shot Trunk Relay per Bulletin PI0924." For future diagnosis for an inoperative trunk release, this relay installation will be identified before a BCM is replaced.

1. Label the four leads of connector, P/N 12126045 as indicated below.
2. Connect the connector to the new relay, P/N 19119267.
3. Locate circuit 6188 (trunk release control) at the BCM following service information. Cut the wire and splice the BCM and relay side of the circuit as shown below.
4. Connect wire fused, unswitched power and ground as shown below.

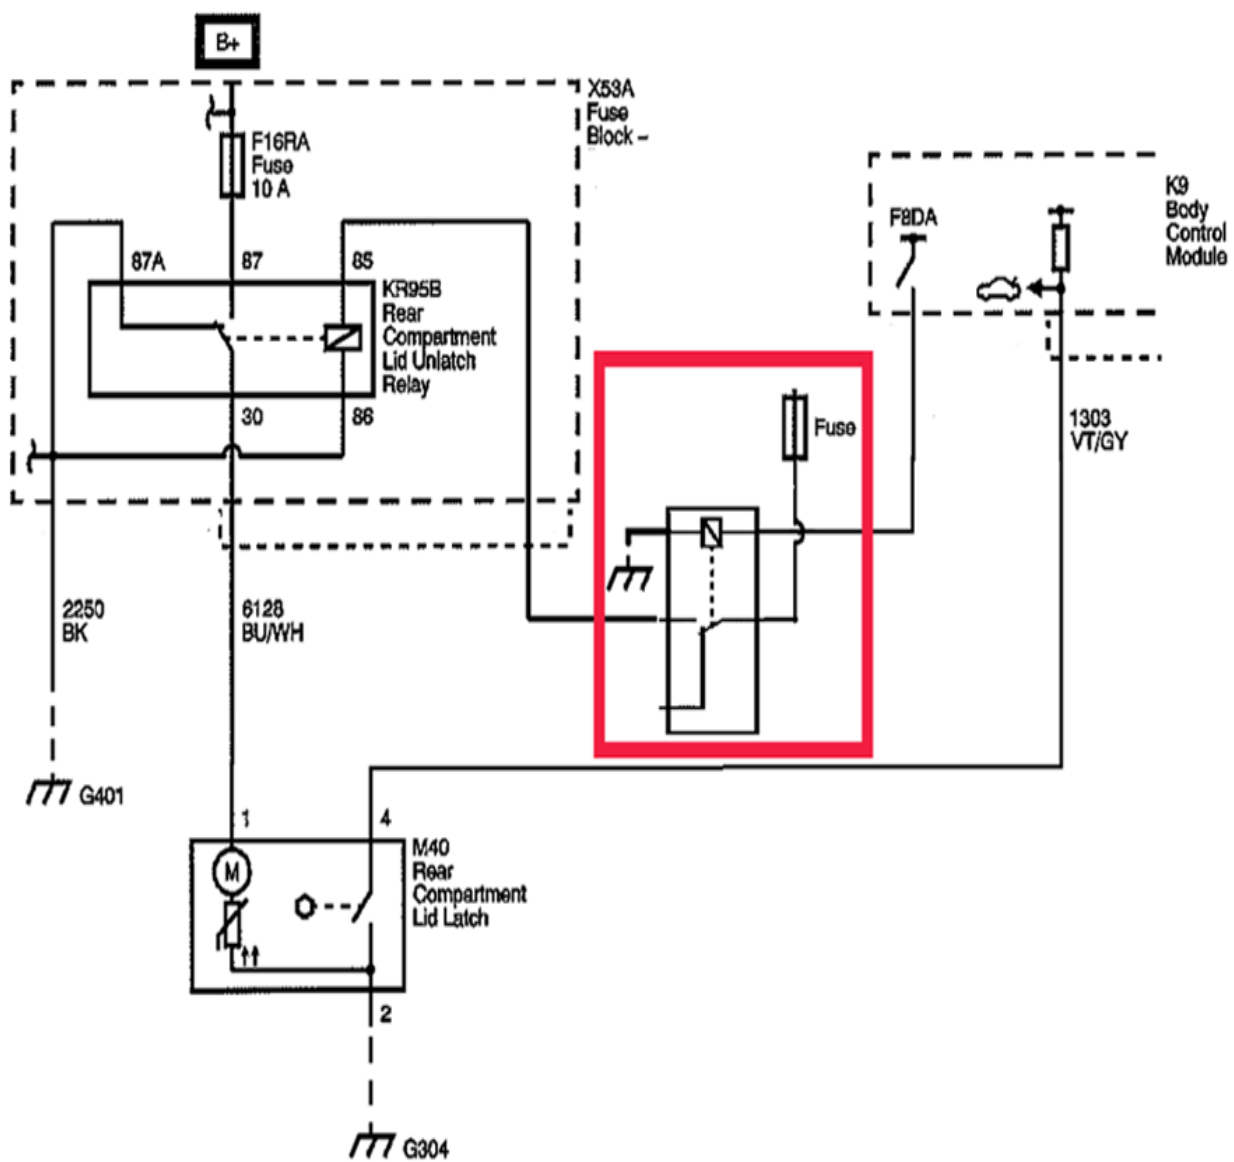

3329904

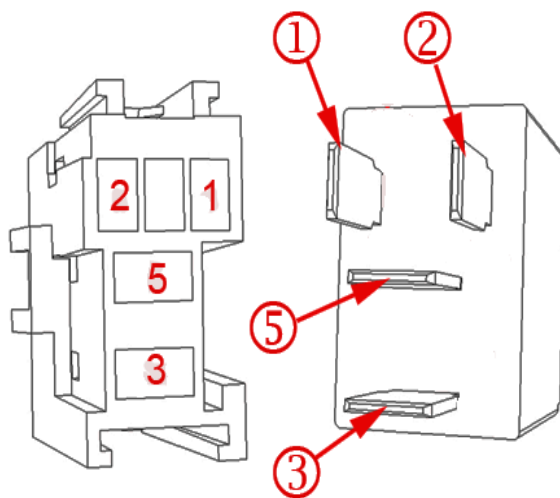

3329906

**Legend**

- (1) BCM Circuit No. 6188
- (2) Ground
- (3) Relay Circuit No. 6188
- (5) Fused 12V Power

---

**Customer Information**

Please communicate to the customer that once this repair is completed, the remote transmitter (key fob) trunk release button, the exterior rear compartment lid release switch (touch pad) or the interior rear compartment lid release switch must be pressed twice within three seconds to release the trunk. Please share this information with the customer, including a copy of this message.

**Parts Information**

Part Number	Description	Qty
19119267	Relay, Rear Compartment Lid Release (2-Shot Trunk Release Relay)	1
12126045 (Regal, Sonic Only)	Connector	1

**Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2680118* (LaCrosse, Regal (2011 Germany Built), Verano, Cruze and Malibu)	Installation of Two Shot Trunk Release Relay	0.3 hr
2680118* (Regal (2011 Oshawa Built, 2012-2014) and Sonic)	Installation of Two Shot Trunk Release Relay	1.0 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		