Service Bulletin

Bulletin No.: PIP5231A

Date: Oct-2014

PRELIMINARY INFORMATION

Subject: Concern of engine oil dipstick indicating an overfill

Models: 2015 Cadillac Escalade

2014-2015 Chevrolet Silverado 1500 Suburban, Tahoe

2014-2015 GMC Sierra 1500 Yukon

with engines 5.3L, 6.2L RPO's L83, L86

This PI was superseded to update Recommendation/Instructions. Please discard PIP5231.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

The Engine oil dipstick indicates an overfill when performing a PDI or after an oil and filter change.

Recommendation/Instructions

Typically you will find the dipstick indicates an overfill of 1/2qt of Engine oil.

There is no need to drain the oil at this time, as this concern will not damage the engine nor affect operation.

When it is time for the oil change, fill with the recommended amount of engine oil as specified in SI

SI has been updated with the engine oil (with filter) fill specification of 8 quarts or 7.57 Liters for 7.5L 5.3L, 6.2L RPO's L83, L86 engines in the models lists above.

Note: The correct "full" mark is the upper dimple and the "add" mark is the lowest bottom dimple on the Engine oil dipstick

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION