

Cover of storage slot at front under roof liner (FF8) not fitting.

Topic number	LI68.30-N-059117
Version	2
Design group	68.30 Coverings, trim
Date	10-13-2014
Validity	Model 906 with CODE FF8 (1 DIN slot at front under headliner)
Reason for change	Damage code added
Reason for block	

Complaint:

Cover (1) of storage slot at front under roof liner (FF8) not fitting.

Cause:

Minimum dimensions of the cutout in roof liner is too large leading to an insufficient overlap by the cover (1) (A 906 695 0130).

Remedy:

1. Remove cover (2) or installed electrical equipment
2. Remove carrier
3. Unclip cover (1)
4. Cut felt strip (3) to size (dimensions: 240mm x 5mm)
5. Stick felt strip (3) onto bottom of cover (1) (see Figure 02 and Figure 03)
6. Assemble in the reverse order

Attachments	
File	Description
01.jpg	1 DIN slot
02.jpg	Positioning of felt strip (3)
03.jpg	Felt strip (3) attached

Symptoms

Body / Interior equipment / Interior trim / Bad fitting

Parts


Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 000 983 89 10			Felt strip	1	(Cut to 240 x 5mm). Can be used for several vehicles.	X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			8221Y 42	Equipment installation frame not fitting



Validity		
Vehicle	Engine	Transmission
Sprinter III	*	*

Attachments

01.jpg:

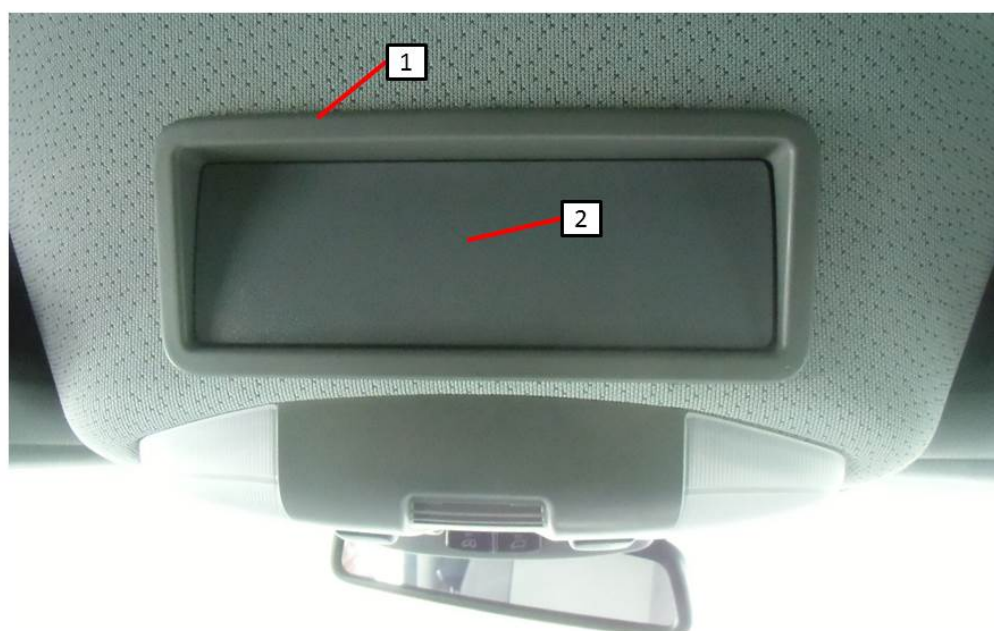

02.jpg:

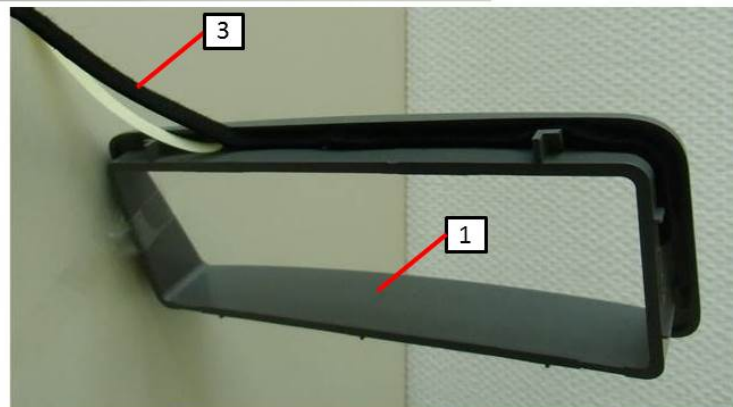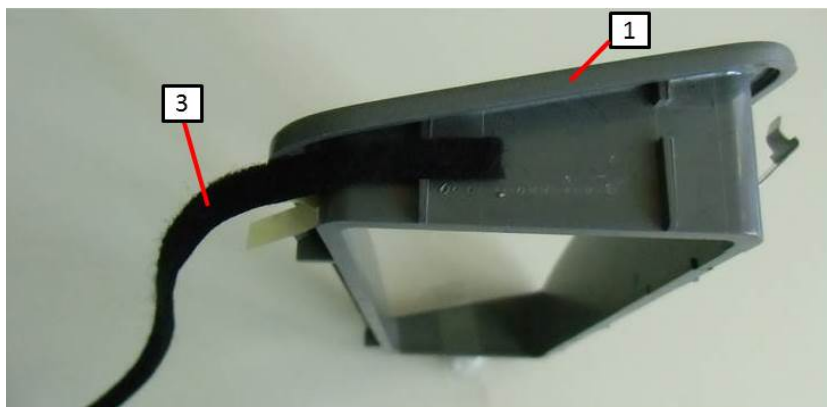

03.jpg:

