Fault in particulate sensor

Topic number LI49.00-P-060010

Version 1

Design group 49.00 General
Date 10-14-2014

Validity Model 166 / 251 with OM642 and MY13 (code 803)

Reason for change Reason for block

Complaint:

Fault in particulate sensor

Cause:

Various causes

Remedy:

If during a diagnosis Xentry instructs you to replace the particulate sensor, proceed as follows:

- 1. Install new particulate sensor
- 2. Perform redocumentation of SA code 450

To do this, make the following selections in Xentry:

- a. Tab "Special functions"
- b. Entry for retrofits and conversions
- c. Select "+" and insert code 450
- 3. Program engine control unit with up-to-date software

Note:

If the latest engine control unit software is already installed, SCN coding is sufficient once the particulate sensor has been replaced and redocumentation performed.

Symptoms

Power generation / Engine management / Engine management indicator lamp / Engine diagnosis / lit

| Parts | | | | | | | | |
|-----------------|-----|-----|--------------------|----------|------------------|-----|--|--|
| Part number | ES1 | ES2 | Designation | Quantity | Note | EPC | | |
| A 000 905 86 02 | | | Particulate sensor | 1 | Model series 166 | Х | | |
| A 000 905 84 02 | | | Particulate sensor | 1 | Model series 251 | Х | | |



| Work units | | | | | | | |
|------------|----------------|------|-------------|--|--|--|--|
| Op. no. | Operation text | Time | Damage code | Note | | | |
| | | | 14507 73 | Soot particulate sensor - Electrical fault | | | |

| Validity | | | | | | | |
|----------|--------|--------------|--|--|--|--|--|
| Vehicle | Engine | Transmission | | | | | |
| M (166) | 642 | * | | | | | |
| R (251) | 642 | * | | | | | |