
Uncomfortable 1-2 shifts in MODEL 166 MODEL YEAR 14 with ENGINE 278

Topic number	LI27.00-P-059983
Version	2
Design group	27.00 General
Date	10-13-2014
Validity	Model Year 14 vehicle 166 with engine M278
Reason for change	Added required PTSS case documents
Reason for block	

Complaint:

In light-throttle situations, the 1-2 upshift can be uncomfortable.

Cause:

The topic is currently under analysis

Remedy:

Check the adaptation of element B1:

- If the fill time adaptation (FZA) of the 1-2 and/or 3-2 shift is near the positive or negative limit (+/-20), please create a PTSS case with EEPROM *.log file and current quicktest. Front line agent will respond with next steps.
- If the fill time adaptation (FZA) of the 1-2 and/or 3-2 shift is in the normal range, please adapt the affected shifts. If this does not remedy the complaint, please do not perform any further adaptations or repairs to the transmission.

This LI will be updated as soon as a remedy is available.

Symptoms
Power transmission / Automatic transmission / Automatic transmission - function / Shifting is rough
Power transmission / Automatic transmission / Automatic transmission - function / Poor shift quality

Validity		
Vehicle	Engine	Transmission
GL (166)	278	722
M (166)	278	722