

Front window drops down after closing

Topic number	LI72.40-P-060085
Version	1
Design group	72.40 Door control
Date	10-23-2014
Validity	207 Cabrio only
Reason for change	
Reason for block	

Complaint:

Front windows drop down 1 inch after closing, express close function does not operate

Cause:

Window loses normalization.

Remedy:

Due to small variances in the window seal compression over time and usage, window normalization allows the window motor to know when the window is fully closed.

Note: The windows can always be re-normalized using the procedure explained in the owners manual under Side windows > Resetting

Please verify the reason for lost normalization through:

DCU-XX > Actual values > Power window > Frequency counter 'Denormalization of power windows'

If no fault codes are present in the DCU, and the actual value for '985 Watchdog reset during actuation of power window' is greater than 0, this issue is under investigation.

If any other actual value counter is greater than 0, please continue with diagnosis.

Symptoms
Body / Glazing / Window lifting mechanism/window operation / Does not run up
Body / Glazing / Window lifting mechanism/window operation / Does not run down
Body / Glazing / Window lifting mechanism/window operation / Opens by itself

Validity	Vehicle	Engine	Transmission
	E (207)	*	*