

Modified gearshift adaptation in MODEL 205 with AGILITY SELECT switch (CODE B59)

Topic number	LI27.00-P-058876
Version	2
Design group	27.00 General
Date	06-02-2014
Validity	MODEL 205 with TRANSMISSION 722.9 (CODE 427) and AGILITY SELECT switch (CODE B59)
Reason for change	Remedy adapted.
Reason for block	

Complaint:

In MODEL 205 vehicles with TRANSMISSION 722.9 in combination with AGILITY SELECT switch (CODE B59), it must be ensured that the adaptation of the gearshifts is performed only in transmission mode "E".

Adaptation in transmission mode C, S or S+ could result in either incorrect adaptation values being saved or none at all.

Cause:

When the gearshift is triggered with the shift paddles, the correct fill time adaptation values are taken into account in transmission mode "E" only.

Remedy:

In the event of shift quality complaints in transmission mode C, S, S+ or M, manual adaptation must only be performed in transmission mode "E".

Symptoms
Power transmission / Automatic transmission / Automatic transmission - function / Shifts
Power transmission / Automatic transmission / Automatic transmission - function / Poor shift quality

Validity		
Vehicle	Engine	Transmission
205.003	651	722.908
205.004	651	722.908
205.008	651	722.908
205.040	274	722.995
205.042	274	722.995
205.045	274	722.995