



**NUMBER:** 08-013-14

**GROUP:** Electrical

**DATE:** February 01, 2014

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.*

**THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-028-13, DATED APRIL 25, 2013, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **\*\*ASTERISKS\*\*** AND INCLUDES NEW UPDATED SOFTWARE AND MORE IMPROVEMENTS.**

**SUBJECT:**

RA2 Radio Enhancement

**OVERVIEW:**

This bulletin involves updating the radio's software.

**MODELS:**

2014	(WD)	Durango
2014	(WK)	Grand Cherokee

**NOTE: This bulletin applies to vehicles built on or before December 22, 2013 (MDH 1222XX) equipped with UConnect 5.0 AM/FM/BT (sales code RA2).**

**SYMPTOM/CONDITION:**

The customer may notice one or more of the following.

- Paired phone list is deleted after ignition cycle.
- **\*\*Not able to pair phone\*\***.
- **\*\*Unable to delete paired device from list\*\***.
- **\*\*Removed the ability to pair phones while the vehicle is in motion\*\***.
- **\*\*Voice command not able to play new text messages\*\***.
- **\*\*SXM presets are lost at times\*\***.
- **\*\*SXM disappeared and failed to re-register\*\***.
- **\*\*Intermittently the wrong selected media is played\*\***.
- **\*\*Noises (pops and cracks) for AM/FM\*\***.
- **\*\*Audio controls are locked out after using VR\*\***.
- **\*\*IPOD will not resume playing after phone call\*\***.
- **\*\*IPOD 'Repeat' function is not turned on\*\***.
- **\*\*IPOD songs not accessible through VR without 'genre'\*\***.
- **\*\*IPOD shuffle does not continue after ignition cycle\*\***.
- **\*\*Not able to restore to default setting\*\***.
- **\*\*Potential for battery draw on E-Call function\*\***.
- **\*\*Steering wheel control seek up/down function not working \*\***.
- **\*\*Steering wheel control press and hold skipping channels \*\***.

- **\*\*Intermittently the wrong pop-ups or displays is shown\*\*.**
- **\*\*Intermittently the phone or media will freeze\*\*.**
- **\*\*Presets or clock setting are lost after software updates\*\*.**
- **\*\*Climate ON/OFF pop-up will not longer appear\*\*.**
- **\*\*Can't change media source to Disc\*\*.**
- **\*\*Wrong EQ setting being used\*\*.**
- **\*\*Mute function not working correctly\*\*.**
- **\*\*No audio on phone calls\*\*.**

### **Improvements**

- **\*\*VR command, prompts and recognition\*\*.**
- **\*\*Blue Tooth Streaming Audio, connection and playing\*\*.**
- **\*\*Audio during hands free calling\*\*.**
- **\*\*Phone book downloading and display\*\*.**
- **\*\*Retaining/storing all presets and improvements to presets from skipping channels\*\*.**
- **\*\*Text message downloading and playing\*\*.**

### **DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available. If Audio DTC's are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

If the customers describe the symptom/condition, perform the Repair Procedure.

### **PARTS REQUIRED:**

Qty.	Part No.	Description
1 (AR)	68236610AA (Estimated time for availability 02-17-14)	Update disc

**NOTE: Software updates are now available for download to USB on the Uconnect web site and can be used instead of ordering a disc.**

**NOTE: Updates are still available via an update disc. If ordering a disc, only one update disc is required and each disc may be used to service multiple vehicles. Warranty will only reimburse one of each update disc per dealer.**

### **REPAIR PROCEDURE:**

1. Has the USB update memory sticks been created?
  - a. Yes >>> Proceed to [Step #3](#).
  - b. No >>> Proceed to [Step #2](#).
2. Go to DealerCONNECT>Service>UCONNECT Information & Utilities> Uconnect Dealer software downloads to down load the files. Follow the instructions on the web site to create the USB memory stick.

**NOTE: A blank USB stick must be used to down load the software. The memory stick should be 4 GB or larger.**

**NOTE: If the dealer cannot down load the software, make sure you have proper security access. If not have the Service Manager or Shop Foreman down load the software update. If the Service Manager or Shop Foreman can't down load the software, an update disc can be ordered. If using a CD to down load the software follow the instruction on the CD to properly transfer the correct software to a USB stick.**

3. Turn the engine on and check if the vehicle is still in ship mode. This will be displayed in the Electronic Vehicle Information Center (EVIC).
4. The vehicle must be in Customer Mode to update the radio. Is the vehicle in Ship Mode?
  - a. Yes >>> Proceed to [Step #5](#).
  - b. No >>> Proceed to [Step #6](#).
5. Use the scan tool (wiTech) to put the vehicle into customer mode.
6. With the engine running and radio powered on, insert the **correct** USB Stick with new software into USB hub.
7. The next screen display will have the old and new software levels. The radio will be updated to 13.49.0.
8. Is the current software level at or higher then the update to software level?
  - a. Yes >>> The bulletin is doesn't pertain, normal diagnostic should be performed.
  - b. No >>> Proceed to [Step #9](#).
9. Press the soft key "Yes" to start the update.
10. The update may take 12 minutes, no other actions will be needed.

**NOTE: If the software update process is interrupted/aborted, the process should be restarted.**

**NOTE: Do not cycle the ignition or touch the radio during the update process.**

11. After the update is done, the screen will is display the software levels again.

**NOTE: Please note during this process the screen will go blank 2 times. Once in the beginning and once at the end of the re-flash process.**

12. Press "No" and turn off the vehicle. Open and then close the drivers door and let the Buss go to sleep. This will complete the radio update.
13. Remove the USB update stick, the bulletin has been completed.

**NOTE: Use the wiTech to put the vehicle back into Ship Mode if needed.**

***POLICY:***

Reimbursable within the provisions of the warranty.

***TIME ALLOWANCE:***

Labor Operation No:	Description	Amount
18-60-02-AS	Radio, Check Software Level and Perform Software Update (0 - Introduction)	0.3 Hrs.
18-60-02-AT	Radio Software - Create USB Update Stick	0.2x Hrs

	(First Time Only) (0 - Introduction)	
--	--------------------------------------	--

**NOTE:** The expected completion time for the flash download portion of this procedure is approximately 12 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

**NOTE:** The “First Time Only” LOP is used one time per dealer when down loading the software onto a USB stick.

***FAILURE CODE:***

ZZ	Service Action
----	----------------