

Service Bulletin

File in Section: 06 - Engine

Bulletin No.: 14-06-04-001

Date: January, 2014

TECHNICAL

Subject: Service Engine Soon (SES) Light Comes On with DTCs P0420, P0430 Set

Models: 2009-2011 Chevrolet Corvette ZR1

Equipped with 6.2L Engine (RPO LS9)

Condition

Some customers may comment that the service engine soon (SES) light is on. Technicians may find DTCs P0420, P0430 stored in history.

Recommendation/Instructions

For the 2009-2011 model year exhaust systems, replace the catalytic converter and pipe assemblies, in between the exhaust manifolds and mufflers, with the 2012-2013 model year parts numbers listed below and update the ECM calibration.

Important: The technician will have to call in a for a VCI number provided by the Techline Customer Support Center (TCSC). Updating the components without the cal will cause the SES light to come on.

Parts Information

| Part Number | Description | |
|-------------|------------------------------|--|
| 25958412 | Exhaust Pipe Assembly | |
| 25958408 | Converter Pipe Assembly – RH | |
| 25958409 | Converter Pipe Assembly – LH | |

Warranty Information

For vehicles repaired under the U.S. (5 years/100,000 miles) or Canadian (8 years/130,000 km) Powertrain Warranty, use:

| Labor Operation | Description | Labor Time |
|--------------------|--|---------------|
| 4080278* | Both Converter Pipes and Exhaust Pipe Replacement | 2.6 hrs |

^{*}This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.

Note: The labor time includes Engine Control Module Reprogramming with SPS.