



Service Bulletin

PRELIMINARY INFORMATION


Subject: Squeaking/Creaking Type Noise Heard When Using Clutch Pedal

Models: 2012-2013 Chevrolet Cruze Equipped with Manual Transmission (RPOs MF3, MR5, MZ0)
2012-2013 Chevrolet Sonic Equipped with Manual Transmission (RPOs MZ4, M26)

This PI has been revised to add the Cruze to the Models section and update the Labor Operation to the Global Labor Code (GLC). Please discard PI0965.


Condition/Concern

Some customers may comment on a squeaking/creaking type noise heard when using the clutch pedal.

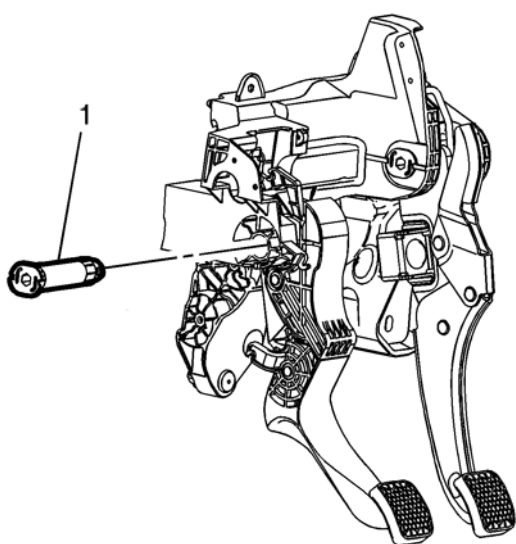

This may be caused from lack of or no lubrication on the clutch pedal pin (1) shown in the illustration above.

Recommendation/Instructions

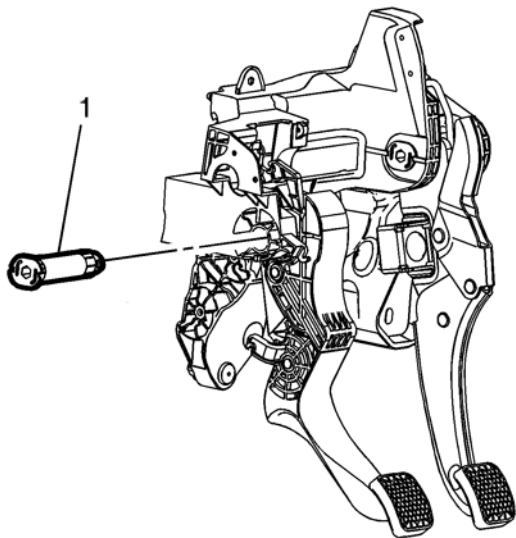

Apply GM Super Lube Part Number 12346241 (in Canada use 10953474) or equivalent around all the gaps on the clutch pedal pin (1) in the illustration above.

Note: **DO NOT** remove the clutch pedal pin during the lubrication process.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8480098*	Lubricating Clutch Pedal Pin	0.2 hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION