



Service Bulletin

PRELIMINARY INFORMATION

Subject: Adaptive Forward Lighting Service Message Displayed on DIC, DTC B257C or B257D Set

Models: 2014 Buick LaCrosse
Equipped with Adaptive Forward Lighting (RPO TF4)

Condition/Concern

Some customers may comment on a AFL (Adaptive Forward Lighting) Lamps Need Service message being displayed on the DIC. This condition may be intermittent and occurs on initial start up in cold ambient temperatures.

When checking the vehicle for DTCs, U1531 or U1532 may be set in history. In some cases, B257C, B257D or U1501 may also be set in history.

Recommendation/Instructions

An updated software calibration has been released to address this concern. Reprogram the headlamp control module (HCM) using the Service Programming System (SPS) with the latest calibrations available on TIS2WEB. Reprogram the module if any of the codes listed are in history, even if the vehicle is not currently exhibiting the condition. Refer to the Headlamp Control Module Programming and Setup procedure in SI.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2810475	Headlamp Control Module Reprogramming with SPS	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION