



NUMBER: 14-002-14

GROUP: Fuel System

DATE: April 22, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Engine Stall Immediately Following Fuel Tank Fill-Up (X53 Lifetime Warranty Extension)

OVERVIEW:

This bulletin involves replacing the fuel tank with a revised part.

MODELS:

2005 - 2006 LX 300/Charger/Magnum

NOTE: This bulletin applies to vehicles equipped with a 19 gallon fuel tank (sales code NFK).

SYMPTOM/CONDITION:

Some customers may experience an engine stall condition just after filling the fuel tank. The integral multi-functional control valve may allow liquid fuel to enter the evaporative emissions system causing a rich fuel condition when the purge system is initiated..

DIAGNOSIS:

If the customer describes the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	CNSTX531AA	Tank, Fuel
1	CNSTX532AA	Package, O-Ring & Fastener

REPAIR PROCEDURE:

1. Replace the fuel tank. Refer to the detailed removal and installation procedure available in DealerCONNECT> Service> TechCONNECT> Service Info> 14 - Fuel System> Fuel Delivery> Fuel Tank> Removal/ Installation.

POLICY:

Reimbursable within the provisions of the warranty.

NOTE: Vehicles included in this Service Bulletin have a lifetime warranty for this repair. See Warranty Bulletin; U.S. D-14-05, Canada SAB 2014-08, Mexico BG-06-14 or International ID-14-01 for details associated with the extended warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
14-60-01-9A	Tank, Fuel - Replace (1 - Semi-Skilled)	8 - Engine Performance	2.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------