



NUMBER: 23-009-14 REV. A

GROUP: Body

DATE: June 24, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 23-009-14, DATED MARCH 27, 2014, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDE ADDITIONAL DECKLID SPOILER PART NUMBERS.**

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 14-032 ALL APPLICABLE SOLD AND UN-SOLD RRT VIN's HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Gap At Rear Spoiler To Decklid

OVERVIEW:

This bulletin involves inspecting and if necessary replacing the rear deck lid spoiler.

MODELS:

2013 JS 200

NOTE: This bulletin applies to vehicles built on or before July 22, 2013 (MDH 0722XX) equipped with the Mopar Special Edition spoiler.

SYMPTOM/CONDITION:

Gap at the rear decklid spoiler

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1(AR)	82213326AC	Spoiler - Black (PX8)
1(AR)	82213339AC	Spoiler - Deep Cherry Red Crystal (PRP)
**1(AR)	82213688AC	Spoiler - Tungsten Metallic Clear Coat

Qty.	Part No.	Description
		(PDM)**
1(AR)	82213338AC	Spoiler - Bright White Clear Coat (PW7)
1(AR)	82213337AC	Spoiler - Billet Silver Metallic Clear Coat (PSC)
1(AR)	NPN	Isopropyl Alcohol

REPAIR PROCEDURE:

1. Apply vertical upward finger load on rear most edge of spoiler at the body cross car centerline and 4" from outboard ends (Fig. 1)(Fig. 2). Inspect rear edge of spoiler for tape adhesion, was the adhesive separated and/or separating (Fig. 3)?
 - a. Yes>>> Proceed to Step 2.
 - b. No>>> Return the vehicle the customer or dealer inventory.



Fig. 1 Spoiler Inspection 1

- 1 - Spoiler
- 2 - Decklid



Fig. 2 Spoiler Inspection 2

1 - Areas to apply vertical upward finger load

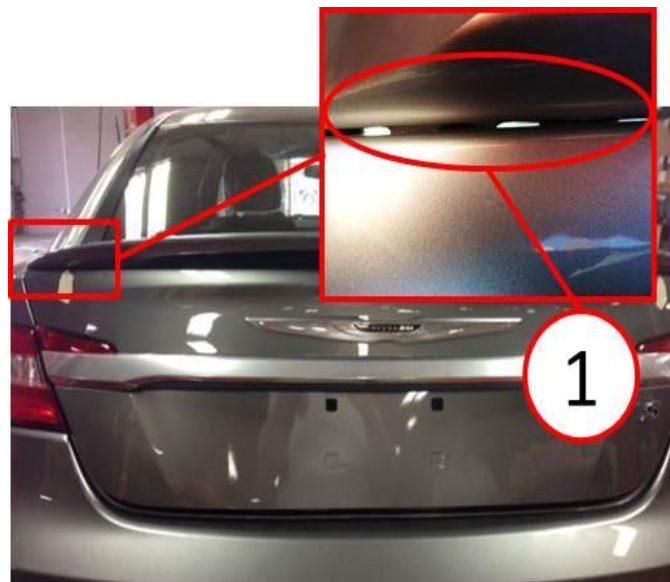


Fig. 3 Adhesion Inspection

1 - Adhesion failure

2. Remove and replace the deck lid spoiler. Refer to the detailed repair procedures available in: DealerConnect> TechCONNECT under: Service Info> 23 -Body> Exterior> Spoiler> Removal/Installation.

NOTE: Clean the surface area where the two sided tape will bond to the deck lid with isopropyl alcohol prior to installing the replacement spoiler.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
23-02-06-98	Inspect Decklid Spoiler (1- Semi-Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
23-02-06-99	Inspect And Replace Decklid Spoiler (1- Semi-Skilled)	6 - Electrical and Body Systems	0.3 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------