



NUMBER: 08-057-14 REV. A

GROUP: Electrical

DATE: August 02, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-057-14, July 17, 2014, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDE NEW PART NUMBERS FOR THE TRUNK TRIM PANELS AND THE REMOVAL OF THE SUB-WOOFER.**

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 14-052. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Removal Of Beats Audio System

OVERVIEW:

This bulletin involves replacing the A-pillar trim panels, cargo covers, and amplifier.

MODELS:

2014 FF 500 (South Korea Only)

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair.

PARTS REQUIRED:

Qty.	Part No.	Description
1	**1TN82KA9AA**	**Trunk Side Trim Panel (right side) **
1	**5LC73KA9AA**	**Trunk Side Trim Panel (left side)**
4	06030441	Push Pins
1	05091804AE	Amplifier
1	1UY00KA9AB **(with out hole)** or 1RZ39KA9AE **(with hole)**	Load Floor
1	1SC52TRMAD	A-Pillar (right side)

Qty.	Part No.	Description
	(JD7 dark gray, JXW black, JW4 ivory)	
1	1SC53TRMAD (JD7 dark gray, JXW black, JW4 ivory)	A-Pillar (left side)

REPAIR PROCEDURE:

1. **Disconnect the battery negative cable .
2. Replace the A-Pillar trim panels.
3. Partially remove door seal at A-Pillar.
4. Using trim stick C-4755 or equivalent, starting at the bottom and working up, pry the A-pillar trim panel retaining clips out from the vehicle A-pillar.
5. Release black tether on A-Pillar trim panel.
6. Disconnect speaker electrical connector.
7. Flex A-Pillar trim panel out of headliner.
8. Remove A-Pillar trim panel from vehicle, verify orange retaining clip is still attached. If retaining clip remains in the body panel then remove and discard it.

NOTE: The lower orange retainer clip may break during removal .

9. Transfer speaker to new A-pillar trim panel.
10. Remove the orange retainer clip from the new A-pillar trim panel.
11. Fully insert new orange retainer clip into the A-post body panel.
12. Slide new A-post trim panel over the retainer clip.
13. Snap A-pillar trim panel into retainer clip.
14. Connect speaker electrical connector.
15. Connect black tether.
16. Flex A-Pillar trim panel into headliner.
17. Snap A-pillar trim panel into place.
18. Install weather strip at A-Pillar. **
19. Repeat steps 2 through 18 for the other A-Pillar trim panel.
20. Replace the Amplifier, refer to the detailed removal and installation procedures available in DealerCONNECT> TechCONNECT> under: Service Info> 08 - Electrical> Audio/Video/Entertainment/Connectivity>AMPLIFIER, Removal/Installation.
21. Replace the Cargo side trims panels, refer to the detailed removal and installation procedures available in DealerCONNECT> TechCONNECT> under: Service Info> 23 - Body> Interior> PANEL, Quarter Trim Rear, Removal/Installation.

NOTE: **Remove the Sub-Woofer and discard, tape connector back to prevent rattle.**

22. Replace the rear cargo load floor.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
23-20-16-94	Panels, BEATS Audio System - Replace (1 - Semi-Skilled)	6 - Electrical and Body Systems	1.2 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------