



NUMBER: 08-080-14

GROUP: Electrical

DATE: September 17, 2014

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

RA3 RA4 Radio Update To Improve Back Up Camera Display, Remote Audio Device Distortion, And WiFi Connectivity

OVERVIEW:

This bulletin involves inspecting and, if required, updating the radio software.

MODELS:

2015 (UF) 200

NOTE: This bulletin applies to vehicles built on or before September 09, 2014 (MDH 0909XX) and equipped with a Uconnect 8.4A AM/FM/BT/ACCESS (sales code RA3) or Uconnect 8.4AN AM/FM/BT/ACCESS/NAV (sales code RA4) radio.

SYMPTOM/CONDITION:

A customer may arrive at the dealership with the following concerns:

- Rearview Camera image appears jittery.
- Inability to establish a WiFi connection when security feature is enabled.
- Audio distortion/popping heard while playing Apple devices through the USB port..
- Navigation system improvements.
- Remote Uconnect Apps functions (i.e. door locks, remote start) inoperative while the engine is running.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available, verify all vehicle systems are functioning correctly. If any DTCs are present, record them on the repair order and repair as necessary before proceeding further with this bulletin.

If a customer describes the symptom/condition above, perform the Repair Procedure.

REPAIR PROCEDURE:

CAUTION: This software update is only compatible with the 2015 model year vehicles listed above. Attempting to flash a 2013-2014 model year vehicle with this software will result in a loss of some radio/navigation functions. Should this occur reinstalling the correct software for the radio will correct the condition.

1. Has the USB stick been created?
 - a. Yes >>> Proceed to [Step #5](#).

- b. No >>> Proceed to [Step #2](#).
2. Go to DealerCONNECT> Service> UCONNECT Information & Utilities> Uconnect Dealer software downloads to download the files.
3. If a security message appears “Do you want to view only the webpage content that was delivered securely?” see ([Fig. 1](#)). Press **No** to continue.

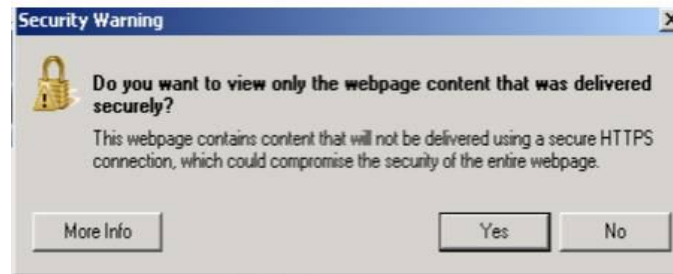


Fig. 1 Pop-up Security Message

NOTE: A blank USB stick must be used to download the software. Only one software update can be used on one USB stick.

NOTE: If the dealer cannot download the software, make sure you have proper security access. If not, have the Service Manager or Shop Foreman download the software update.

4. To download the software files to a USB stick, follow the on screen instructions and perform the following.
 - a. Acquire a blank USB stick with at least 4 gb of space.
 - b. Download the software update file to your local pc's desktop.
 - c. Be sure to extract the file before copying it to the blank USB stick.
 - d. A blank USB stick will be needed one for each radio update, additional updates can not be on the same USB stick.
 - e. Once the file is saved to the USB stick, label it with the bulletin number and proper radio sales codes.

NOTE: The vehicle must be in Customer Mode to update the radio.

5. Start the vehicle and check if it is still in ship mode. This will be displayed in the Electronic Vehicle Information Center (EVIC).
6. Is the vehicle in Ship Mode?
 - a. Yes >>> Proceed to [Step #7](#).
 - b. No >>> Proceed to [Step #8](#).

- 7. With the key in the "on" position, turn on the hazard lamps, then press and hold the up arrow on the steering wheel for 5 seconds. The EVIC display will update once the vehicle goes into customer mode. Once the mode has been changed, turn off the hazard lamps.
- 8. With the engine running and radio powered on, insert the **correct** USB stick with new software into USB port.
- 9. The next screen display will have the old and new software levels. The radio will be updated to 14.35.0.
- 10. Is the current radio software version 14.35.0 or higher?
 - a. Yes>>> The radio software is already up to date. The bulletin is complete.
 - b. No>>> The radio software needs to be updated. Proceed to [Step #11](#).

CAUTION: If the radio software level is at or above the level on the USB stick, DO NOT perform the update.

11. Press the soft key "Yes" to start the update.

NOTE: If the software update process is interrupted, aborted or failed, the process should be restarted.

NOTE: Do not cycle the ignition or touch the radio during the update process.

- 12. The update may take up to 20 minutes to load. No other actions will be needed to initiate the update.
- 13. After the update is done, the screen will display the software levels again.
- 14. Press "No" and turn the vehicle off. Open and close the driver's door and let the Bus go to sleep.

NOTE: Make sure to leave ignition off, do not press the brake, and do not reopen any doors, so the modules will go to sleep.

- 15. Cycle the ignition on, then back off one more time. Open and close the driver's door and let the Bus go to sleep. This will complete the radio update.
- 16. Remove the USB stick, the bulletin is now complete.

NOTE: If necessary, be sure to put the vehicle back into ship mode once the procedure is complete.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-60-02-DA	Radio, Software - Create USB stick, From CD or Uconnect Website (One Time Only) (0 - Introduction)	6 - Electrical and Body Systems	0.2 Hrs
18-60-02-CY	Radio, Check Software	6 - Electrical and Body	0.2 Hrs

	Level Only (0 - Introduction)	Systems	
18-60-02-CZ	Radio, Check Software Level and, Perform Software Update (0 - Introduction)	6 - Electrical and Body Systems	0.4 Hrs.

NOTE: The “One Time Only” LOP is used one time per dealer when downloading the software onto a USB stick. The dealer can only use the download LOP, one time for each of the radios.

NOTE: The expected completion time for the flash download portion of this procedure is approximately 25 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.

FAILURE CODE:

ZZ	Service Action
----	----------------