



SI B63 03 14  
Lights

January 2014  
Technical Service

## SUBJECT

**After Deleting Transport Mode, Daytime Running Light Is Switched Off**

## MODEL

F15

## SITUATION

After deleting transport mode during PDI (Pre Delivery Inspection-QC I), fault code “8041A9 - Daytime running light lock active” is present in the BDC (Body Domain Controller) and the DRL (Day Running Light) is switched off.

## CAUSE

Software in the BDC

## PROCEDURE

After deleting transport mode is completed, go back to the control unit tree screen:

- Select the BDC.
- Select control unit function.
- Select control unit reset.

After the control unit reset, you will be able to delete the fault memory, and the DRL light will be activated.

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty.

<b>Defect Code:</b>	<b>61 38 27 02 00</b>	
<b>Labor operation</b>	<b>Labor Allowance</b>	<b>Description</b>
61 99 000	1 FRU	Work time to reset BDC after deleting transport when performing QCI

Even though work time labor operation code 61 99 000 ends in “000,” it is not considered a Main labor operation.

[ Copyright ©2014 BMW of North America, Inc. ]