

SI B63 05 14 Lights

January 2014 Technical Service

SUBJECT Adaptive Headlight Malfunction in Cold Weather

MODEL F01 F02

F10

F15

F32

Produced from June 30, 2013 to March 30, 2014

With option code SA0524 (Adaptive Headlights)

SITUATION

- In very cold weather conditions (32°F or below) with the light switch in the automatic position, the CCM (Check Control Message) "Adaptive headlight malfunction" is displayed.
- When the CC message is displayed, all the lights continue to function.
- When switching the headlights to high beam and the headlight unit is cold, the mechanism inside the headlight is too stiff to move.

CAUSE

Software error in TMS 3 (Headlight driver module AHL xenon light)

PROCEDURE

DO NOT replace the TMS 3.

The fault cannot be reproduced in the workshop when the vehicle/headlight is warm. The new software to fix this situation will be available in mid-March 2014 (ISTA/P 2.52.1). Advise the customer to cycle the ignition off/on to clear the CCM after the vehicle warms up.

This Service Information bulletin will be updated once the ISTA/P software is available.

WARRANTY INFORMATION

Not applicable.

[Copyright ©2014 BMW of North America, Inc.]