



This Service Information bulletin supersedes SI 65 23 13 **dated December 2013.**

NEW designates changes to this revision

SUBJECT

Headunit-High: Navigation Road Map Installation After Replacement

MODEL

NEW

F01, F02 (7 Series Sedan)

F02H (ActiveHybrid 7)

F06 (6 Series Gran Coupe)

F07 (5 Series Gran Turismo)

F10 (5 Series Sedan)

F10H (ActiveHybrid 5)

F12 (6 Series Convertible)

F13 (6 Series Coupe)

F15 (X5)

F22 (2 Series Coupe)

F25 (X3)

F30 (3 Series Sedan)

F30H (ActiveHybrid 3)

F31 (3 Series Sports Wagon)

F32 (4 Series Coupe)

F33 (4 Series Convertible)

F34 (3 Series Gran Turismo)

Produced from July 2012

With option 609 (Navigation System Professional, HU-H)

and

Without option 6VA (CIC contribution)

INFORMATION

The replacement Headunit-High (HU-H) always comes with the latest Navigation Road Map database installed.

SITUATION

When replacing the HU-H, the road map database version that was in the defective HU-H must be installed in the new HU-H.

PROCEDURE

IMPORTANT: Before replacing the defective HU-H, identify the NAV road map version installed in the defective HU-H.

1. Identify the NAV road map version installed in the defective head unit, using the iDrive controller:

- Turn the ignition on
- Select the menu “NAV”
- Press the button “Option” (next to the iDrive controller)
- Scroll down to the bottom of the menu and select “Navigation system Version”

If this is no longer possible:

- Read out the information via the remote key in the Key Reader.

Note: If the NAV road map version installed on the replacement HU-H is the same as the one installed on the defective HU-H, no further action is necessary. Otherwise proceed to step 2.

2. **NEW** Install the appropriate HU-H NAV road map through ISTA/P; refer to Attachment A.

NEW IMPORTANT: The NAV road map installation can no longer be performed using the DVD sets in the vehicle!

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty, if required and performed in conjunction with a covered repair to replace the Headunit-High (HU-H).

Defect Code:	Claim with the “Defect Code” used for the HU-H replacement	
Labor Operation:	Labor Allowance:	Description:
65 90 600	Refer to KSD	Installing navigation road map(s)

Labor operation code 65 90 600 is an associated labor operation.

ATTACHMENTS

View PDF attachment [B652313 Attachment A](#).

[Copyright ©2014 BMW of North America, Inc.]