

Measure no.

US 57242219-01

Subject

Bench seat cover is wavy

Status date (mm/dd/yy)

2/25/14

Status

Accepted

Organization

US, MOT

Date created (mm/dd/yy)

2/25/14

Created by

Christine Koehling

PQM Problem reference**Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

Vehicles affected**E series**

K51

Engine**Body****Production period (from/to)**

(mm/dd/yy)

/

Comment on production period

From SOP

Feedback (all cases relating to**measure up to) (mm/dd/yy)**

Complaint

Cover of bench seat is wavy. See 1st picture.

Cause

The various colors of the bench seat cover are sealed together and then folded, see (1) and (2) in 2nd picture. If this is twisted, the cover may be uneven (3).

Measure

To eliminate the fault, proceed as follows:

- At the end of the seam, check the direction in which the fold has been turned, see (4) and (5).
- Take the twisted seam between your thumb and index finger; the thumb must be pointing in the direction in which the seam should be turned. (It is best to use both hands)
- Pull the seam upwards.
- Turn the welded seam in the same direction that it is on the edge of the pan. If required, repeat the process.

Complaint**Fault location**

71/60 Accessories for body

Fault type

High spot

Fault place

Cause

#	Fault location	Fault type	Fault place
1	52/51 Seat	Structural defect, fabric defect	
	Repair Task	Special Clearance	Area
	Other tasks	No	Body and Trim

#	Fault location	Fault type	Fault place
2	52/53 Seat bench	Waviness, uneven surface	
	Repair Task	Special Clearance	Area
		No	Body and Trim

Fault code

Progman / DIS / ISTA / ISTA/P

System	State	Version
--------	-------	---------

© 2002-2014 BMW OF NORTH AMERICA, LLC. ALL RIGHTS RESERVED.





(1)



(2)



(3)



(4)



(5)