



PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES BEFORE CUSTOMER DELIVERY OR THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS.

SUBJECT

Service Action: Check Door Pull Trim and Replace if Needed

MODEL

F80 (M3 Sedan)

F82 (M4 Coupe)

Produced from March 18, 2014 to May 7, 2014

SITUATION

The trim on the door pull may become easily detached.

CAUSE

Manufacturing tolerances and a defect in workmanship may cause the door pull trim to release.

AFFECTED VEHICLES

This Service Action involves F80 and F82 vehicles produced from March 18, 2014 to May 7, 2014.

First check if a Service Action label with a code number **694** is already attached to the B-pillar.

If a code number **694** has been punched out, the Service Action has already been performed and no further action is necessary.


Vehicles which require this Service Action to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

CORRECTION

Check all four (F80) or both (F82) door pull trims and replace as needed.

PROCEDURE

Check the trim fitment on all door pulls.

	<ol style="list-style-type: none"> 1. Check the lower catch locking by pulling on the trim at the location shown. <p>Note: Do not use any tools. Only use your fingers to determine if the trim is locked correctly.</p>
--	--



2. Check the center catch locking by pulling on the trim at the locations shown.


Note: Do not use any tools. Only use your fingers to determine if the trim is locked correctly.

If any of the trims can be detached by hand without the use of tools, they must be replaced.

PARTS INFORMATION

Part Number	Description	Quantity
51 41 8 057 633	Left leather door pull trim (Black)	1-2
51 41 8 057 634	Right leather door pull trim (Black)	1-2
51 41 8 057 635	Left leather door pull trim (Silverstone 2)	1-2
51 41 8 057 636	Right leather door pull trim (Silverstone 2)	1-2
51 41 8 057 637	Left leather door pull trim (Sakhir Orange)	1-2
51 41 8 057 638	Right leather door pull trim (Sakhir Orange)	1-2
51 41 8 057 639	Left leather door pull trim (Sonoma Beige)	1-2
51 41 8 057 640	Right leather door pull trim (Sonoma Beige)	1-2

LABEL INSTRUCTIONS

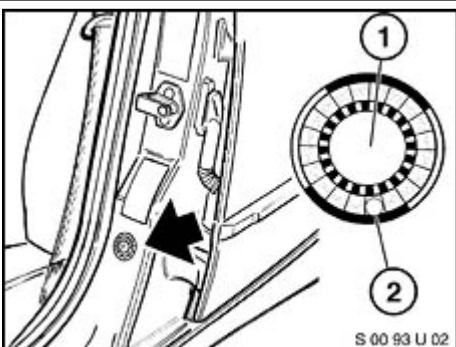

This Service Action has been assigned code number **694**. After the vehicle has been checked and/or corrected, obtain a label (SD 92-439) and:

- A. Emboss your BMW center warranty number in the middle of the label (1);
- B. Punch out code number **694** (2), printed on the label; and
- C. Affix the label to the B-pillar as shown.

If the vehicle already has a label from a previous Service Action/Recall Campaign, affix the new label next to the

old one. Do not affix one label on top of another one because a number from an underlying label could appear in the punched-out hole of the new label.

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information.

F82 (M4 Coupe)

Defect Code:	00 51 41 03 00	
Labor Operation:	Labor Allowance:	Description:
00 62 690	3 FRU	Check trims (No repair is necessary)
Labor Operation:	Labor Allowance:	Description:
00 62 691	3 FRU	Check trims and replace one trim
00 62 692	3 FRU	Check trims and replace two trims

F80 (M3 Sedan)

Labor Operation:	Labor Allowance:	Description:
00 62 693	4 FRU	Check trims and replace three trims (F80 only)
00 62 694	4 FRU	Check trims and replace four trims (F80 only)

All the labor op codes listed above are Plus labor operations.

[Copyright ©2014 BMW of North America, Inc.]