



This Service Information bulletin supersedes SI B63 13 14 **dated November 2014**.

**PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES BEFORE CUSTOMER DELIVERY OR THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS.**

**NEW** designates changes to this revision

#### SUBJECT

**Service Action: Radio Reception Interference Due to Taillight**

#### MODEL

F16 (X6)

**NEW** Vehicles produced from August 1, 2014 to October 30, 2014

#### **NEW** SITUATION

A Service Action for a Delivery Stop has been issued on certain F16 vehicles produced from August 1, 2014 through October 30, 2014.

When the brakes are applied, there is an interference noise from the radio in the very high frequency range from 104 MHZ to 107 MHZ.

Affected vehicles in dealer inventory must not be retailed or delivered until this issue is corrected. Vehicles at ports of entry will be repaired prior to dealer delivery.

Affected vehicles can be identified with a "Vehicle Comment" in DCS Warranty Vehicle Inquiry, or ISPA Light with the description

#### **NEW** CAUSE

Faulty hardware in the left rear taillight

#### **NEW** AFFECTED VEHICLES

This Service Action involves certain F16 vehicles produced from August 1, 2014 through October 30, 2014.

First check if a Service Action label with a code number **723** is already attached to the B-pillar.

If a code number **723** has been punched out, the Campaign has already been performed and no further action is necessary.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

#### PROCEDURE

Replace the left rear light unit on the tailgate following ISTA Repair Instructions REP 63 21 245 or the repair instructions attached to this Service Information bulletin.

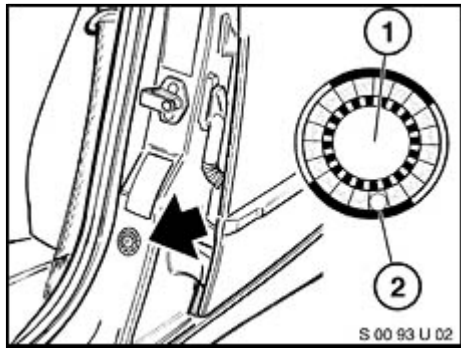
#### PARTS INFORMATION

Part Number	Description	Quantity

63 21 2 576 429

Rear light in trunk lid, left

1

**NEW LABEL INSTRUCTIONS**

This Service Action has been assigned code number **723**. After the vehicle has been checked and/or corrected, obtain a label (SD 92-464) and:

- A. Emboss your BMW center warranty number in the middle of the label (1);
- B. Punch out code number **723** (2), printed on the label; and
- C. Affix the label to the B-pillar as shown.

If the vehicle already has a label from a previous Service Action/Recall Campaign, affix the new label next to the old one. Do not affix one label on top of another one because a number from an underlying label could appear in the punched-out hole of the new label.

**NEW WARRANTY INFORMATION**

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

<b>Defect Code:</b>	<b>00 63 34 01 00</b>	
Labor Operation:	Labor Allowance:	Description:
00 62 865	6 FRU	Replacing left-hand rear light

Labor operation code 00 62 865 is a Plus labor operation.

**ATTACHMENTS**

View PDF attachment [B631314 Attachment](#).

[ Copyright ©2014 BMW of North America, Inc. ]