



PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES BEFORE CUSTOMER DELIVERY OR THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS.

SUBJECT

Service Action: Replace Oil Filter Housing Assembly

MODEL

F56 (Cooper)

With B38 engine

F56 (Cooper S)

With B48 engine

SITUATION

A coolant leak could occur at the oil filter housing, resulting in overheating, loss of power and an engine warning light.

AFFECTED VEHICLES

This Service Action involves F56 models (MINI Cooper and Cooper S) produced from 3/12/2014 to 6/17/2014.

First check if a Service Action label with a code number **74** is already attached to the B-pillar.

If a code number **74** has been punched out, the Campaign has already been performed and no further action is necessary.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

PROCEDURE

For vehicles that are still in dealer inventory, replace the oil filter housing assembly by performing the attached step-by-step procedure.

For vehicles that have already been delivered to Motorers, please call them and invite them back to the dealership so that their MINIs can be repaired. When the Motorers bring their MINIs to your dealership, please provide them with a MINI service loaner from your AMP fleet.

PARTS INFORMATION

Part Number	Description	Quantity
11 42 8 585 235	Oil filter housing assembly	1

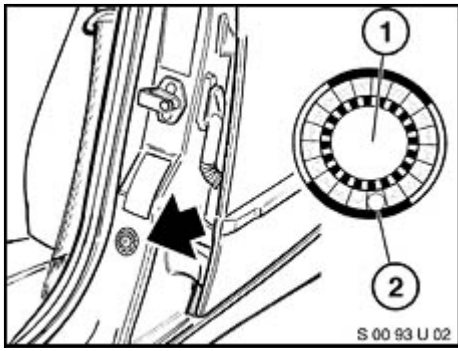
Sublet – Bulk Materials

Part Number	Description	Quantity
82 14 0 031 133	Antifreeze (1 gallon = 2 gallons at 50/50 mix)	As required

07 51 0 143 829

Motor oil SAE 5W-30 Longlife

1 quart

LABEL INSTRUCTIONS

This Service Action has been assigned code number **74**. After the vehicle has been checked and/or corrected, obtain a label (MD20-064) and:

- A. Emboss your MINI dealer warranty number in the middle of the label (1);
- B. Punch out code number **74** (2), printed on the label; and
- C. Affix the label to the B-pillar as shown.

If the vehicle already has a label from a previous Service Action/Recall Campaign, affix the new label next to the old one. Do not affix one label on top of another one because a number from an underlying label could appear in the punched-out hole of the new label.

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:**00 11 49 03 00****Vehicle in stock, prior to delivery:**

Labor Operation:	Labor Allowance:	Description:
00 62 830	F56 B38 = 31 FRU	Replace oil filter housing assembly
	F56 B48 = 25 FRU	

Labor operation code 00 62 830 is a Plus labor operation.

Vehicles delivered to the customer:

Labor Operation:	Labor Allowance:	Description:
00 62 200	F56 B38 = 33 FRU	Replace oil filter housing assembly
	F56 B48 = 26 FRU	

Labor operation code 00 62 200 is a Main labor operation.

Sublet - Materials

Sublet Code 4	See sublet reimbursement calculation below	Reimbursement for repair-related materials (Do not use the MINI part numbers for claim submission)
---------------	--------------------------------------------	----------------------------------------------------------------------------------------------------

Sublet reimbursement calculation for claiming used quantities of repair-related materials:

- MINI Antifreeze/Coolant (one-gallon container P/N 82 14 0 031 133) for the required refill quantity (50/50 mixture) at dealer net plus handling.
- MINI Motor Oil SAE 5W-30 Longlife (one quart, P/N 07 51 0 143 829) at dealer net plus handling.

Enter this material cost as one combined sublet amount, and itemize it in the claim comment section.

MINI F56 QUALITY LAUNCH SUPPORT PROGRAM

MINI USA recognizes that this situation is an inconvenience to our new and current Motorers. In an effort to address this concern, you may offer your Motorer up to \$250.00 in MINI MotoringGear and/or F56 accessories.

Note: The \$250.00 amount is based only on the MINI “Dealer Net price” in effect as determined by the repair date entered on the corresponding DCSnet claim submission. Please do not include the part “handling” amount when performing this calculation.

When the claim is paid, the applicable handling will be credited, so be sure to include the handling amount in your expected claim payment totals.

For accessories that require installation, this \$250.00 can be applied to parts and/or labor.

Submit the claim, as outlined below, on the affected F56 VIN that is pending delivery or has been delivered to a Motorer. Field authorization (FAS) is not required.

Note: Always check the DCSnet Warranty Vehicle Inquiry “Repair History (Claims)” sections first before proceeding with the launch support program.

Defect Code:	85 10 02 39 NA	Oil Filter Housing Assembly MINI F56 Quality Launch Support
---------------------	-----------------------	----------------------------------------------------------------

MINI MotoringGear

Part Number	Description	Quantity
MINI Part Number(s)	MINI MotoringGear	As applicable

And/or:

F56 Accessories for Motorers

Labor Operation:	Labor Allowance:	Description:
Refer to KSD2	As applicable	Installation labor for F56 accessories for Motorers

Part Number	Description	Quantity
MINI Part Number(s)	F56 accessories for Motorers	As applicable

ATTACHMENTS

View PDF attachment [M110914 Instructions](#).