

From: [Broadcast Messaging System](#)
To: [DL-BMS_Message_Monitors](#)
Subject: i3 BEV - A/C Not Cooling, IRAP Solution
Date: Monday, June 16, 2014 5:21:41 PM

Publish Date: June 16, 2014
From: Technical Service
Expiration Date: July 16, 2014

DCSnet Message
Urgent



Subject: **i3 BEV - A/C Not Cooling, IRAP Solution**

Customer may complain that the A/C system does not operate on i3 BEV. ISTA diagnosis shows IHKA fault 801130 (Heat Pump general functional error), in some cases accompanied with consequential faults for the heat pump pressure/temperature sensor, or switch valve. Do not replace any components, since this situation is caused by a software error. To eliminate this software glitch, a temporary IRAP solution has been implemented. In case of customer's complaint of A/C inoperative (with the FC 801130 stored), submit a PuMA case titled "I01BEV - No A/C" requesting IRAP programming. Make sure that the vehicle's integration level is at 14-03-505 prior to the IRAP session. SI B64 02 14 is going to be released shortly.

Attachments:

No Attachments No Attachments

Recipients: BMW Passenger Cars, Service, All Regions, All Areas, Service, All
BMW Passenger Cars, CC-RegionalTechEngineers
BMW Passenger Cars, CC-AreaManagers
BMW Passenger Cars, CC-AfterSalesAreaManagers

