

Measure no.

US 58253615-01

Subject

Loose screw by starter

Status date (mm/dd/yy)

4/23/14

Status

Accepted

Organization

US, MOT

Date created (mm/dd/yy)

4/23/14

Created by

Peter Loertzing

PQM Problem reference**Release date (mm/dd/yy)****Approved by****Dealer release**

Allow automatic release

Vehicles affected**E series**

K50 K51 K52

Engine**Body****Production period (from/to)**

(mm/dd/yy)

/ 1/8/14

Comment on production period

Use of screw locking varnish

Feedback (all cases relating to**measure up to) (mm/dd/yy)**

Complaint

A screw by the starter is loose.

Cause

The screw for the starter double wheel is loose (see 1st picture).

Measure

Remove the screw, be sure NOT to remove the starter

double wheel axle (item #3 in 2nd picture), apply

Loctite 248 to the screw and tighten to 8 Nm

Complaint

	Fault location	Fault type	Fault place
1	11/00 Engine	Leak: Oil	

Cause

#	Fault location	Fault type	Fault place
1	11/11 Engine housing	Loose screw	
	Repair Task	Special Clearance	Area
	Remove and install	No	Powertrain

Fault code

Progman / DIS / ISTA / ISTA/P

System

State

Version

© 2002-2014 BMW OF NORTH AMERICA, LLC. ALL RIGHTS RESERVED.



