


**SUBJECT**
**Erroneous Check Control Message: Tire Pressure Check Failed**
**MODEL**

F15 (X5)

Produced from SOP through 02/2014

**SITUATION**

After pressing the Start/Stop button, the Check Control message “Tire pressure check failed” appears briefly, as well as the corresponding light on the instrument cluster.

These displays disappear after a few seconds.

**CAUSE**

Software in the BDC (Body Domain Controller)

**CORRECTION**

Run the diagnostics with ISTA/D. Work through the corresponding test module. Program and code the vehicle with ISTA/P 2.52.1 or a more recent version.

- F15 – New Integration Level F025-14-03-502

**WARRANTY INFORMATION**

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty or the BMW Certified Pre-Owned Program.

<b>Defect Code:</b>	<b>61 38 27 02 00</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
00 00 006	Refer to KSD	Performing “vehicle test” (with vehicle diagnosis system – checking faults)
And, if necessary, also		
61 21 528	Refer to KSD	Connect an approved battery charger/power supply (indicated in KSD2 as “Charging battery”)
and		
61 00 730	Refer to KSD	Programming/encoding control unit(s)

Labor operation code 00 00 006 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance. Enter the Chassis Number, which consists of the last 7 digits of the Vehicle Identification Number (VIN). Click on the “Search” button, and then enter the applicable flat rate labor operation in the FR code field.

If a control module was working properly and/or had no related faults stored prior to vehicle programming and it fails to program correctly or requires initialization, this additional work must be claimed with separate labor operations under the defect code listed above; refer to KSD2.

### **Other Repairs**

If performing other ISTA diagnostics and related test plans results with **eligible and covered work**, claim this work with the applicable defect code and labor operations listed in KSD2.

[ Copyright ©2014 BMW of North America, Inc. ]