



SUBJECT

Driver's Footwell Trim Rattles

MODEL

I01 (i3, i3 REx)

SITUATION


The customer complains of rattling noises from the driver's side pedal area.

CAUSE

The retaining tab for the footrest cover bracket rattles against the trim panel.

PROCEDURE

Remove the driver's side footwell trim and install a felt insulator.

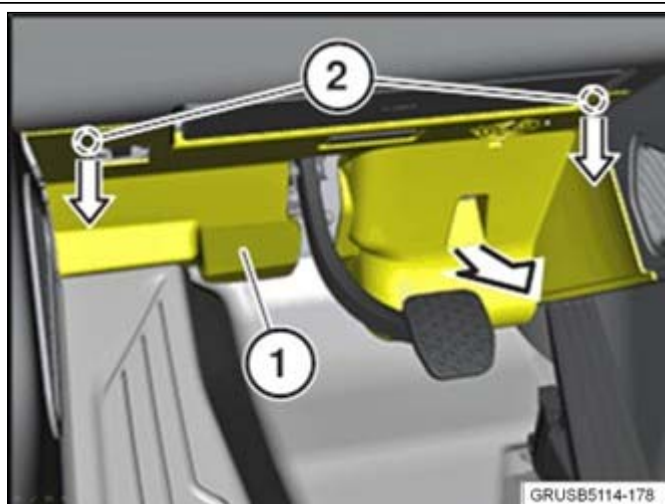


1. Unclip the trim panel (1) from the clamps (2). Lower the trim panel (1) slightly and disconnect the plug connections from behind. Pull out the trim panel (1) towards the rear.



2. Prepare a piece of felt tape (70 mm x 40 mm) and apply the felt so that half of the felt can be wrapped around to the rear area. Shown is the proper location for the front area of the felt.



3. Wrap the remaining felt to the rear side. Shown is the how the back area of the felt should look.

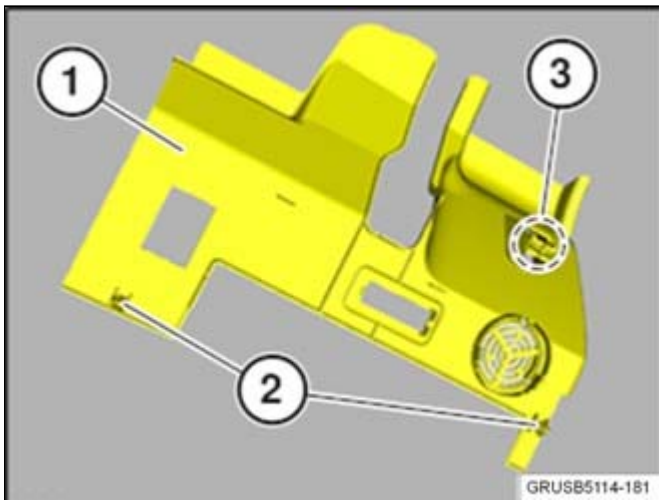

4. Installation note: The clamps (2) and the guide (3) on the trim panel (1) must not be damaged. Insert the guide (3) correctly into the corresponding holder on the vehicle.

When replacing the trim, remount the following parts, depending on the version:

- **Hands-free system speaker**
- Footwell light

PARTS INFORMATION

| Part Number | Description | Quantity |
|-----------------|--------------------|------------|
| 51 45 2 353 024 | Set of felt strips | See sublet |

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty

| | | |
|-------------------------|-------------------------|---|
| Defect Code: | 51 45 02 39 00 | |
| | | |
| Labor Operation: | Labor Allowance: | Description: |
| 51 45 184 | Refer to KSD2 | Remove and install pedal trim |
| and | | |
| 51 99 000 | 2 FRU | Work time to prepare and apply felt piece to pedal trim panel |

Labor operation code 51 45 184 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 51 45 684 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance. Enter the Chassis Number, which consists of

the last 7 digits of the Vehicle Identification Number (VIN). Click on the “Search” button, and then enter the applicable flat rate labor operation in the FR code field.

Even though work time labor operation code 51 99 000 ends in “000,” it is not considered a Main labor operation. Also, since the “work time” FRU allowance to be claimed is specified, a separate punch time is not required.

And

| | | |
|---------------|--------|--|
| Sublet Code 4 | \$1.00 | Reimbursement for the used quantity of felt tape (Bulk reference P/N 51 45 2 353 024, please do not use this part number for claim submission) |
|---------------|--------|--|

[Copyright ©2014 BMW of North America, Inc.]