SUBJECT

Luggage Compartment Open: Check Control Message Displayed

MODEL

F22 (2 Series Coupe)

F23 (2 Series Convertible)

SITUATION

The customer complains that a check control message (CCM) for "luggage compartment open" shows in the instrument cluster, even though the lid is closed.

Additionally, in the case of the F23, the convertible top cannot be opened as a result of the CCM.


CAUSE

The luggage compartment micro switch is not being activated.

PROCEDURE



1. Adjust the luggage compartment lid locking latch lower to allow activation of the micro switch.

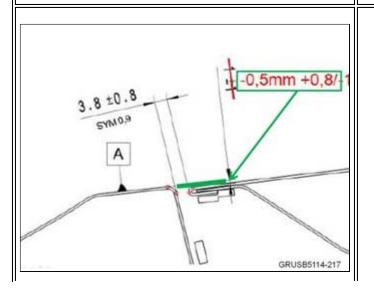

2. In the illustration, the letter A is the rear quarter panel and the other panel is the luggage compartment lid. Adjust the lid locking latch to lower the lid 0.5mm below the quarter panel (A).

After adjustments are made, confirm the CCM is out. Also, for the F23, test for proper convertible top opening and

closing.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty.

Defect Code:	51 24 00 79 00	
Labor Operation:	Labor Allowance:	Description:
51 24 004	Refer to KSD2	Adjusting luggage compartment lid lock

Labor operation code 51 24 004 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 51 24 504 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance. Enter the Chassis Number, which consists of the last 7 digits of the Vehicle Identification Number (VIN). Click on the "Search" button, and then enter the applicable flat rate labor operation in the FR code field.

[Copyright ©2014 BMW of North America, Inc.]