

Uncomfortable 2-3 and 3-4 shifts on MODEL 164 with ENGINE 642 with cold transmission oil

Topic number	LI27.00-P-059383
Version	1
Design group	27.00 General
Date	07-10-2014
Validity	Model 164 with engine 642
Reason for change	Validity and remedy adapted.
Reason for block	

Complaint:

Under certain circumstances, the 2-3 and/or 3-4 upshift can be uncomfortable when the transmission oil is cold.

Cause:

Software

Remedy:

Please update the software of transmission control unit VGSNAG2.

New software is available with add-on 3754 for DVD 03/2014 and add-on 3755 for DVD 05/2014.

- Transmission software A 000 902 47 21 for 300 CDI and 350 CDI.
- Transmission software A 000 902 56 21 for 350 BlueTec.

Symptoms
Power transmission / Automatic transmission / Automatic transmission - function / Shifts
Power transmission / Automatic transmission / Automatic transmission - function / Shifting is not performed or is delayed
Power transmission / Automatic transmission / Automatic transmission - function / Poor shift quality

Work units				
Op. no.	Operation text	Time	Damage code	Note
			54553 90	Transmission software
54-0650	BATTERY CHARGER / MAINTAIN VOLTAGE			
54-1011	SHORT TEST			
54-0991	UPDATE SOFTWARE			

Validity		
Vehicle	Engine	Transmission
GL (164)	642.940	722
GL (164)	642.822	722
GL (164)	642.820	722
M (164)	642.940	722
M (164)	642.820	722