

Noises in area of center console in W 166

Topic number	LI68.20-P-053607
Version	3
Design group	68.20 Center console
Date	07-09-2014
Validity	W166 up to VIN166 ~A110034 / Production date 31.7.2012
Reason for change	Update
Reason for block	

Complaint:

Noise in center console area of W166.

Cause:

Creaking at clip fasteners and contact points of various components.

Remedy:

Complaint/specific application of greases and special lubricants from the noise reduction service set ("Noise Kit").

1. Noise in cup holder area:

Replace front cup holder (valid up to 31.7.2012)

2. Noise in center console ramp area:

Apply thin coat of special lubricant (A000 989 35 60) between center console ramp and cockpit.

Mounting console does not need to be removed here (see picture 1)

3. Noise in central operating unit (COU) faceplate area:

Replace COU faceplate.

4. Noise in armrest handle area:

Unclip cover in direction of travel (picture 2). Check felts and install felts if missing (red arrow).

Apply special lubricant (A000 989 35 60) at marked points (marked in blue).

Attachments	
File	Description
Bild1.jpg	Figure 1
Bild2.jpg	Figure 2

Symptoms
Body / Interior equipment / Stowage box/tray / Noise
Body / Interior equipment / Instrument panel / Noise
Body / Interior equipment / Interior trim / Noise

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma-

							ke part
A 000 580 03 50		Noise reduction service set	1			X	

Validity		
Vehicle	Engine	Transmission
166.003	*	*
166.004	*	*
166.023	*	*
166.024	*	*
166.055	*	*
166.057	*	*
166.058	*	*
166.073	*	*
166.074	*	*

Attachments

Bild1.jpg:



Bild2.jpg:

