

Creaking noise in transition area between instrument panel and center console on model series 222 / 217

Topic number	LI68.20-P-059330
Version	1
Design group	68.20 Center console
Date	07-03-2014
Validity	Model series 222 and 217
Reason for change	
Reason for block	

Complaint:

When on rough roads and with side loads applied to the center console (leg support) cracking noise may occur in the transition between the instrument panel and the center console.

Cause:

The noise is generated at the clipping point between the chrome molding and the cup holder on the stowage compartment.

Remedy:

1. Remove trim piece of front center console (AR68.20-P-2101LF).
2. Apply lubricant (A 000 989 36 60) to clipping points (see picture).
3. Install trim piece of front center console (AR68.20-P-2101LF).

Attachments	
File	Description
Unbenannt.JPG	Application points for lubricant

Symptoms
Body / Interior equipment / Instrument panel / Noise

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 000 989 36 60			Lubricant	1		X	

Work units

Op. no.	Operation text	Time	Damage code	Note
			68114 36	

WIS-References			
Document number	Title	Note	Allocation
ar68.20-p-2101f	Install trim piece at front of center console		Remedy

Validity		
Vehicle	Engine	Transmission
222.004	*	*
222.032	*	*
222.033	*	*
222.057	*	*
222.077	*	*
222.082	*	*
222.085	*	*
222.104	*	*
222.123	*	*
222.132	*	*
222.133	*	*
222.157	*	*
222.162	*	*
222.163	*	*
222.165	*	*
222.167	*	*
222.176	*	*
222.177	*	*
222.178	*	*
222.179	*	*
222.182	*	*
222.185	*	*

Attachments

Unbenannt.JPG:

