

Backrest jams

Topic number	LI91.10-P-059377
Version	1
Design group	91.10 Front seats
Date	07-10-2014
Validity	Model series 216 with code 808
Reason for change	Remedy text revised and damage code added
Reason for block	

Complaint:

Front seat backrest locks at folded-forward position

Cause:

When the seat fore/aft adjustment operating switch is operated manually with the backrest in the folded-forward position, the automatic compensation motion of the backrest may cause locking.

Remedy:

To release the locking, firmly jolt the backrest opposite the direction of travel.

It may be necessary to release the backrest using the DAS (manual adjustment of the backrest angle).

No work on the release mechanism is necessary.

Modified software will prevent the compensation motion in the folded-forward position.

Update the left and right seat control unit N32 to the current software version using Xentry.

Symptoms
Body / Seat / Seat adjustment / Stiff/sluggish
Body / Seat / Seat adjustment / Function error
Body / Seat / Seat adjustment / Does not unlock

Work units				
Op. no.	Operation text	Time	Damage code	Note
			82475 90	Seat adjustment control unit/controller unit

Validity		
Vehicle	Engine	Transmission

216.371	*	*
216.376	*	*
216.377	*	*
216.379	*	*
216.386	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
216.371	273.961	722.770
216.371	273.961	722.904
216.376	275.953	722.649
216.377	156.984	722.907
216.377	156.984	722.930
216.379	275.982	722.649
216.386	273.968	722.904
216.386	273.968	722.961