

Airscarf nonfunctional.

Topic number	LI91.29-P-059366
Version	1
Design group	91.29 Seats - electrical system
Date	07-10-2014
Validity	Model series 230 with SA code 403 (AIRSCARF system)
Reason for change	Damage code, part number and WIS reference added, description of remedy updated
Reason for block	

Complaint:

Airscarf nonfunctional, fuse may have blown.

Cause:

The electrical wiring harness is trapped between the height adjustment gearing and the cushion frame.

Attachments	
File	Description
Sitz 004 _Small_.jpg	Damage profile

Remedy:

Check the electrical wiring harness for damage (see Sitz 004 _Small_.jpg) and repair if necessary.

Then secure the electrical wiring harness using additional cable ties (see Abhilfe.jpg).

Attachments	
File	Description
Abhilfe.jpg	Remedy for attachment of wiring harness using cable ties

Symptoms

Body / Seat / AIRSCARF / Blower nonfunctional

Body / Seat / AIRSCARF / Heater nonfunctional

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 003 997 35 51			Protective hose	1	Length as required	X	
A 901 997 02 90			Cable tie	1		X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			59819 22	Connector/line for airscarf fan


WIS-References			
Document number	Title	Note	Allocation
ar00.19-p-0001a	Repair wiring harness		Remedy

Validity		
Vehicle	Engine	Transmission
230.454	*	*
230.458	*	*
230.470	*	*
230.471	*	*
230.477	*	*
230.479	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
230.454	272.949	722.999
230.458	272.968	722.904
230.470	156.981	722.930
230.471	273.965	722.904
230.477	275.954	722.649
230.479	275.953	722.649
230.479	275.953	722.932
230.479	275.981	722.649
230.479	275.981	722.932
230.479	275.983	722.649
230.479	275.983	722.932

Attachments

Sitz 004 _Small_.jpg:

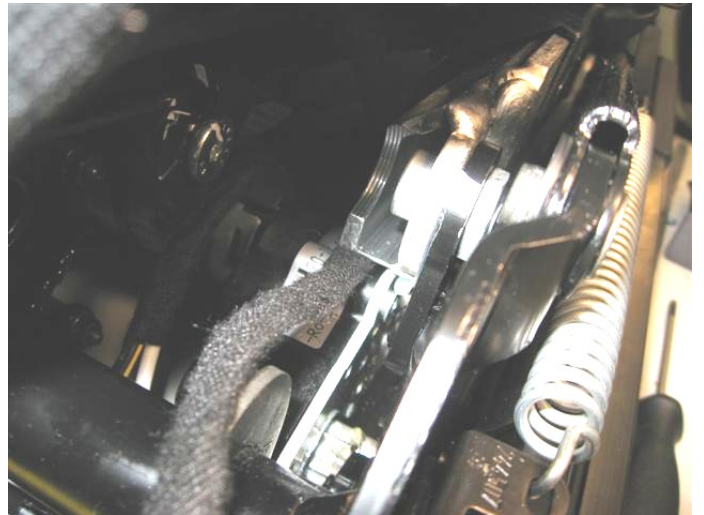

Abhilfe.jpg:

