

Humming noise from engine compartment

Topic number	LI43.05-P-058344
Version	1
Design group	43.05 Vacuum pump
Date	01-31-2014
Validity	G 500, G 65 AMG as of code XZ2
Reason for change	
Reason for block	

Complaint:

Constant noise from the engine compartment.

Cause:

Interlock switch vacuum pump runs constantly, check valve missing.

Remedy:

Install check valve as shown in the attached pictures.

Attachments	
File	Designation
Durchflussrichtung.jpg	Valve flow direction
Verbauort.jpg	Installation location

Symptoms

Chassis/suspension / Brake system / Service brake / Brakes, Vacuum System / Vacuum pump leaky/noises

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 002 140 84 60			Valve	1	Flow direction to pump.	X	

Work units

Op. no.	Operation text	Time	Damage code	Note
		3 AW	43051 36	

Validity

Vehicle	Engine	Transmission
G (463)	279	*
G (463)	273	*

Attachments

Durchflussrichtung.jpg:



Verbauort.jpg:

