Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Campaign No. 2013090008, February 2014

Revision Date Purpose

B 02/21/14 Revision to Warrranty information
A 11/18/13 Update to work Procedure

- 10/18/13 Initial release

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: Models 166 (ML), X166 (GL), 204 (C), X204 (GLK), 207 (E-Coupe), 212 (E), 218 (CLS),

231 (SL) Model Year 2013

Update mbrace Control Module Software

This Service Campaign has been initiated because Daimler AG (DAG), the manufacturer of Mercedes-Benz vehicles, has determined that the mbrace software does not correspond to current production configuration. An authorized Mercedes-Benz dealer will update the mbrace control module software at the next workshop visit.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 47,148 vehicles are affected.

Order No. S-SC- 2013090008

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Procedure

i _{Note:}

- Use DAS/Xentry 09/2013 with add-on 3076 or higher.
- Follow the steps exactly as described in DAS/Xentry.
- Connect battery charger (battery voltage >12.5V).
- Ensure all electrical consumers are switched-off.
- In the event of software/SCN update issues, contact Star Diagnosis User Help Desk.
- Refer to Star Diagnosis System (SDS) Best Practices Guide.
- 1. Connect Star Diagnosis to vehicle.
- 2. Update mbrace emergency call system control unit (N123/4) software: Quick test view / mbrace (N123/4) / Adaptations / Control unit programming.
- 3. Follow on-screen instructions.

i Note:

- Refer to: LI82.95-P-056655 for more information.
- Perform service work on other vehicles while the software for the control module is being updated.

i Note:

The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Connect/disconnect battery charger (02-5058)

Star Diagnosis System (SDS), Connect/disconnect (02-4762)

Update emergency call system control module software (02-8294).

Damage Code	Operation Number	Labor Time (hrs.)
54 955 37 8	02-5058	0.1
	02-4762	0.1
	02-8294	0. <mark>3</mark>

i Note

Operation Number labor times are subject to change.