
Noises from individual rear seats

Topic number	LI91.12-P-057916
Version	2
Design group	91.12 Rear seats
Date	04-28-2014
Validity	Model series 222 with code 223 or 224
Reason for change	One operation item (item 5) added to Remedy
Reason for block	

Complaint:

Noises can occur when sitting down or when adjusting the backrests of the individual rear seats

Cause:

Unfavorable component tolerances.

Remedy:

The following steps are to be followed in the case of noise complaints at the rear seat backrest:

1. Remove backrest
2. Remove backrest padding
3. Attach felt material to the backrest frame (see picture PIC_1)
 - At the lower radii
 - At the side frame elements
 - At the upper radii
4. Attach felt material to the rear of the rear backrest padding (not with SA code 406!) (see picture PIC_2)
 - Felt size 70x320 mm
5. Apply a care product to the seat cover and wheel well liner in the area of the contact surfaces between the individual rear seat backrests and the wheel well liner at the C-pillar
(see pictures PIC_3, PIC_4 and PIC_5)
6. Apply a care product to the seat covers in the area of the transition from the rear backrest to the center armrest
(see picture PIC_6)

Attachments	
File	Designation
PIC_1.jpg	Position of felt pieces on backrest frame
PIC_2.jpg	Position of felt pieces on rear of padding
PIC_3.jpg	Area between individual rear seat backrest and wheel well liner
PIC_4.jpg	Area of wheel well liner
PIC_5.jpg	Area of cover of individual rear seat backrest
PIC_6.jpg	Area between individual rear backrests and center armrest

Symptoms
Body / Seat / Seat noises / Grunting

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 000 983 71 10			Felt strip		For step 3	X	
A 000 983 89 10			Felt strip		For step 4	X	
A 001 986 59 71			Leather care foam		For step 5	X	

WIS-References			
Document number	Title	Note	Allocation
AR91.12-P-1620LFA	Remove/install rear seat backrest		Remedy
AR91.18-P-1870LFA	Remove/install cover on re- ar seat backrest	The cover must not be se- parated from the padding. Steps 1-7 are sufficient for the remedy	Remedy


Validity		
Vehicle	Engine	Transmission
222.004	*	*
222.032	*	*
222.033	*	*
222.057	*	*
222.077	*	*
222.082	*	*
222.085	*	*
222.104	*	*
222.123	*	*
222.132	*	*
222.133	*	*
222.157	*	*
222.165	*	*
222.176	*	*
222.177	*	*
222.178	*	*
222.179	*	*
222.182	*	*
222.185	*	*

Full model designation breakdown

Vehicle	Engine	Transmission
222.004	651.921	724.208
222.032	642.861	722.903
222.032	642.861	725.011
222.033	642.867	722.966
222.057	276.960	724.206
222.057	276.960	725.011
222.077	157.985	722.931
222.082	278.929	722.909
222.082	278.929	725.011
222.085	278.929	722.967
222.085	278.929	725.041
222.104	651.921	724.208
222.123	642.861	722.903
222.123	642.861	725.011
222.132	642.861	722.903
222.132	642.861	725.011
222.133	642.867	722.966
222.157	276.960	724.206
222.157	276.960	725.011
222.165	276.824	722.904
222.165	276.824	725.011
222.176	277.980	722.932
222.177	157.985	722.931
222.178	157.985	722.971
222.179	279.980	722.932
222.182	278.929	722.909
222.182	278.929	725.011
222.185	278.929	722.967
222.185	278.929	725.041

Attachments

PIC_1.jpg:

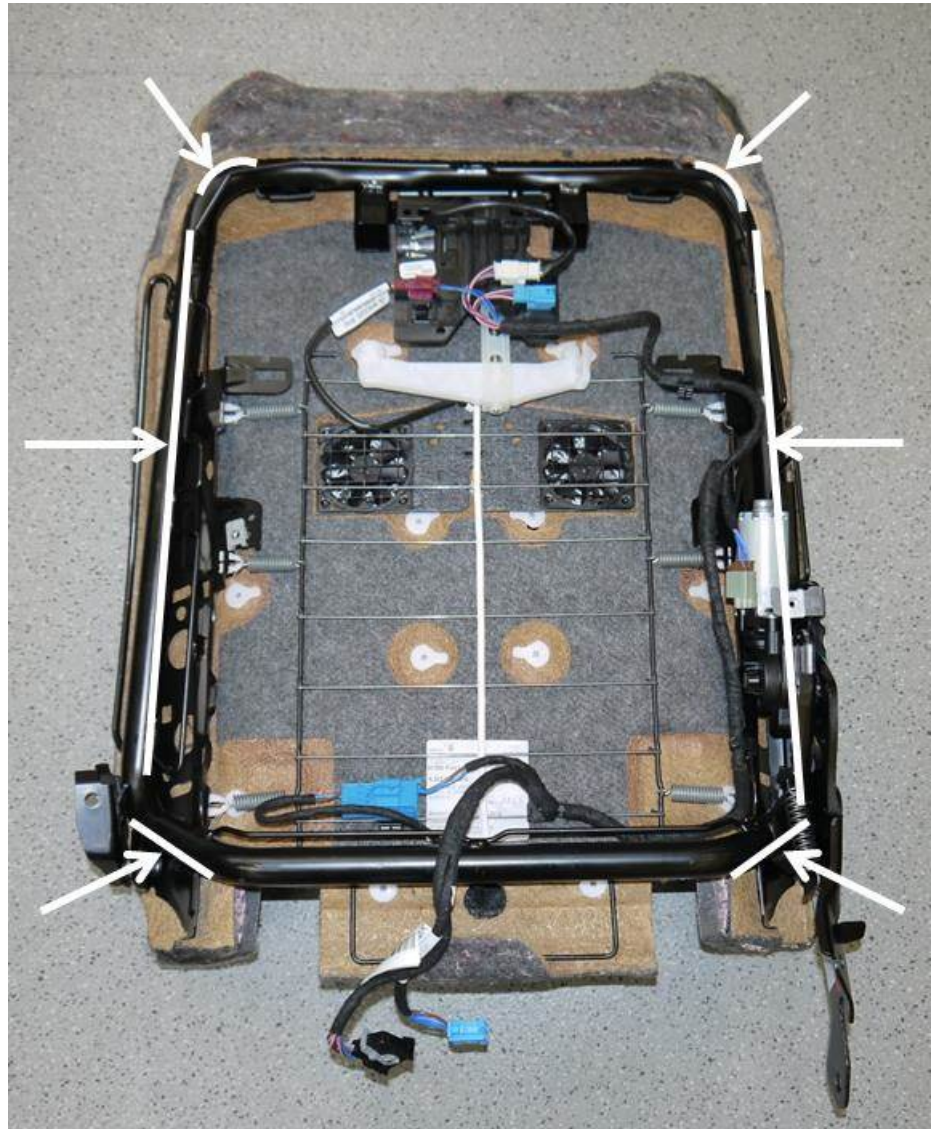

PIC_2.jpg:



PIC_3.jpg:



PIC_4.jpg:



PIC_5.jpg:



PIC_6.jpg:

