

Soot deposits on rear bumper in area of exhaust tips

Topic number	LI49.00-P-058448
Version	2
Design group	49.00 General
Date	03-03-2014
Validity	Engine 271.820/860 EVO in model series 204/207/212 with oval exhaust end pipes
Reason for change	updated complaint
Reason for block	

Complaint:

Soot particles collecting on the bumper. Most visible in the area around the tail pipes, especially on light-colored finishes .

Attachments	
File	Designation
CIMG0737.JPG	Rußablagerungen am Heck/Soot at the rear end

Cause:

Frequent short-distance driving with frequent starts and/or wide open throttle operation.

Remedy:

Install optimized exhaust tip (tip with baffle).

Note:

The modification is permissible only on vehicles fitted with an exhaust tip as standard equipment.

This modification should not performed on vehicles without exhaust tip.

Attachments	
File	Designation
optimierte Blende_.pdf	optimierte Blende/optimised exhaust faceplate

Symptoms
Power generation / Exhaust system / Exhaust system function / fumes/black smoke

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 204 490 77 27			Exhaust tip	1	Single-pipe exhaust system	X	

A 204 490 79 27		Left exhaust tip	1	Twin-pipe exhaust system	X	
A 204 490 80 27		Right exhaust tip	1	Twin-pipe exhaust system	X	

Validity		
Vehicle	Engine	Transmission
204.047	271.860	*
204.048	271.860	*
204.049	271.820	*
204.247	271.860	*
204.248	271.860	*
204.249	271.820	*
204.347	271.860	*
204.349	271.820	*
207.347	271.860	*
207.348	271.860	*
207.447	271.860	*
207.448	271.860	*
212.047	271.860	*
212.048	271.860	*
212.147	271.860	*
212.148	271.860	*
212.247	271.860	*
212.248	271.860	*