

Gap between cap and outside door handle is wedge shaped on driver door

Topic number	LI72.10-P-058636
Version	1
Design group	72.10 Front door
Date	03-04-2014
Validity	Model series 222 as of VIN end no.: A021950 up to VIN end no.: A028925
Reason for change	
Reason for block	

Complaint:

Wedge-shaped gap between cap and outside door handle, see Figure 1.

Attachments	
File	Designation
Bild 1.JPG	Figure 1

Cause:

An assembly flaw in the bearing bracket prevents the cap from being located correctly. When screwed down, the cap is pushed aside by the slider of the bearing bracket.

Remedy:

Replace bearing bracket.

See parts listing for the correct bearing bracket.

Symptoms
Body / Door/Flap / Door / Door handle / Are loose

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 099 760 49 00			Left driver door bearing bracket	1		X	
A 099 760 48 00			Left driver door bearing bracket	1		X	
A 099 760 45 00			Right driver door bearing bracket	1		X	
A 099 760 46 00			Right driver door bearing bracket	1		X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			72B03 D6	
			72P03 D6	

Validity		
Vehicle	Engine	Transmission
S (222)	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
222.004	651.921	724.208
222.032	642.861	722.903
222.032	642.861	725.011
222.033	642.867	722.966
222.057	276.960	724.206
222.057	276.960	725.011
222.077	157.985	722.931
222.082	278.929	722.909
222.082	278.929	725.011
222.085	278.929	722.967
222.085	278.929	725.041
222.104	651.921	724.208
222.123	642.861	722.903
222.123	642.861	725.011
222.132	642.861	722.903
222.132	642.861	725.011
222.133	642.867	722.966
222.157	276.960	724.206
222.157	276.960	725.011
222.162	276.824	722.904
222.162	276.824	725.011
222.165	276.824	722.904
222.165	276.824	725.011
222.176	277.980	722.932
222.177	157.985	722.931
222.178	157.985	722.971
222.179	279.980	722.932
222.182	278.929	722.909

XENTRY

222.182	278.929	725.011
222.185	278.929	722.967
222.185	278.929	725.041