

SERVICE CAMPAIGN BULLETIN


CAMPAIGN REF: 02F
TITLE : Parking Sensors Heli-tape Disc Installation
DOCUMENT # : 11 A 049
AFFECTED VEHICLES : McLaren 650S Coupe and Spider

SITUATION : Quality Engineering at McLaren Automotive have identified that the front parking sensor may incorrectly detect an object when nothing is present in front of the vehicle.

PROCEDURE : Please follow the procedure outlined in this document to install heli-tape discs to the two front centre parking sensors.

INSTALLATION:

1. Clean the surface of the front two centre parking sensors with an alcohol cleaning solution or similar product to remove any dirt and grease (1).

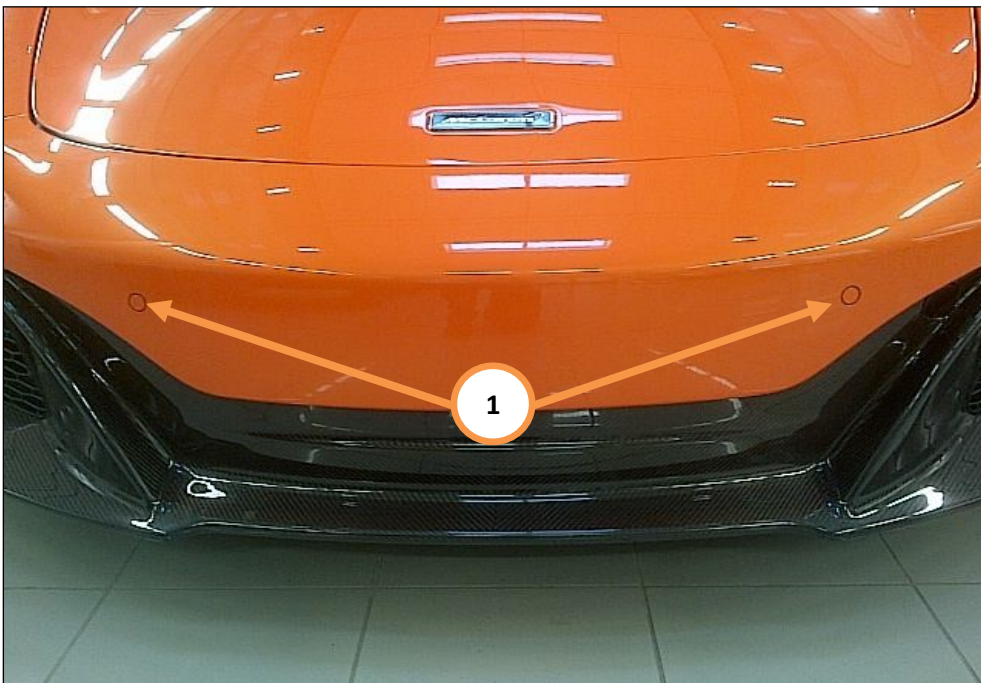

Care Point: Gently apply pressure to the outer ring avoiding direct pressure on the sensor which could cause the sensor to be pushed through the mounting.

2. Install the heli-tape disc 11A4666CP to the two front centre parking sensors ensuring that you have no air gaps (2).



Please contact your Regional Aftersales Manager should you have any questions relating to the information contained in this bulletin.

WARRANTY INFORMATION

DESCRIPTION	RESOLUTION CODE	TOTAL REPAIR TIME
Heli-tape disc installation	M0M20144A33A4A09	0.10 hours

PARTS INFORMATION

PART DESCRIPTION	PART NUMBER	QUANTITY	ORDER PROCESS
Helicopter Tape-Bumpstops	11A4666CP	2	Unipart