



SERVICE BULLETIN

Classification: AT13-021	Reference: NTB14-019	Date: March 21, 2014
-----------------------------	-------------------------	-------------------------

2014 ROGUE; MIL ON WITH DTC P2765, P0500, P1574, P1715 OR P0720

APPLIED VEHICLES: 2014 Rogue (T32)
APPLIED TRANSMISSION: CVT8

IF YOU CONFIRM

The MIL is on with any one of these DTCs alone, or any combination of any of DTCs:

- P2765 – CLUTCH B SPEED SENSOR
- P0500 – VEH SPEED SEN/CIRC
- P1574 – ASCD VHL SPD SEN
- P1715 – INPUT SPEED SENSOR
- P0720 – VEH SPD SEN/CIR

And

- Moisture and/or corrosion is present on or around the Secondary Speed Sensor pins.

ACTION

- Remove the moisture from the Harness connector with CRC QD (or equivalent) electric cleaner.
- Replace Secondary Speed Sensor shown in Figure 1.

NOTE: Figure 1 is for reference only.

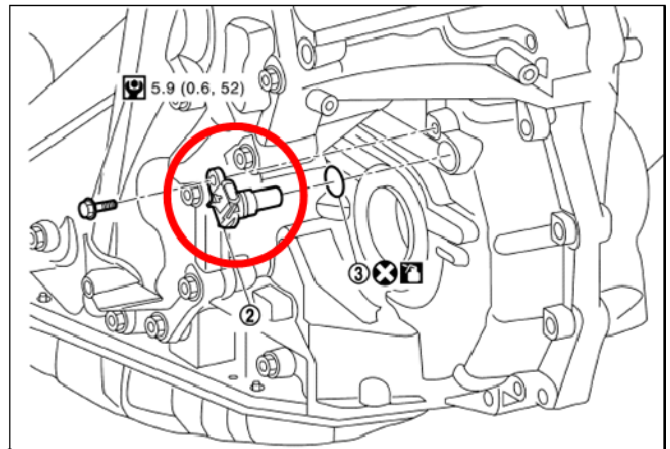


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Secondary Speed Sensor	31935 – 1XF00	1

CLAIMS INFORMATION

OPERATION	OP CODE	PFP	SYM	DIA	FRT
Replace Secondary Speed Sensor	JD75AA	31935-1XF00	HC	32	(1)

(1) Reference the current Nissan Warranty Flat Rate Manual and use the indicated flat rate time.

