

NTB14-044

May 16, 2014

Date:

# 2013 - 2014 SENTRA; MIL ON WITH DTC P0448

APPLIED VEHICLES: 2013 – 2014 Sentra (B17)

### **IF YOU CONFIRM**

EC14-003

The MIL is ON with DTC P0448 (Vent Control Valve).

## ACTION

- 1. Reposition the EVAP canister box-drain.
- 2. Empty water from the EVAP canister filter.

**NOTE:** The Service Procedure in this bulletin should be performed only once per applied vehicle. Check the vehicle service history for the op-code listed in the Claims Information before performing the repairs in this bulletin.

**IMPORTANT:** The purpose of "ACTION" (above) is to give you a quick idea of the work you will be performing. You MUST closely follow the entire Service Procedure as it contains information that is essential to successfully completing the repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

#### SERVICE PROCEDURE

- 1. Remove the rear bumper fascia.
  - Refer to the Electronic Service Manual (ESM), section EXT-Exterior, for removal information.
- 2. Locate the EVAP canister box-drain.
  - The EVAP canister box-drain is located on the passenger side just below the taillight area.

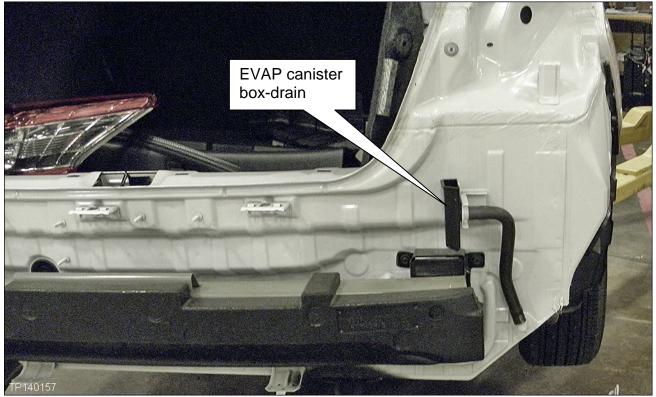


Figure 1

- 3. Remove the EVAP canister box-drain.
  - Pull to unsnap and remove.



Figure 2

4. Clean any dirt, ice, or debris from inside the box-drain.

5. Re-install the EVAP canister box-drain with the **open end down** as shown in Figure 3.

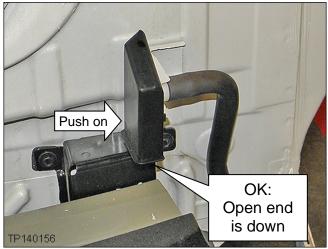


Figure 3

#### NOTE:

- EVAP canister filter for 2014 Sentra is shown in Figure 4, 2013 Sentra is similar.
- Figure 4 shows the canister with the bumper fascia removed.

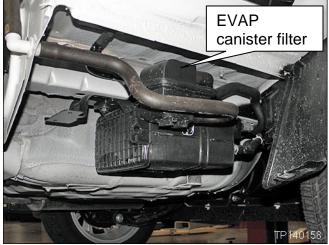


Figure 4

- 6. Remove the EVAP canister filter:
  - Refer to Figure 4, and Figures 5 and 6 on the following pages.
- 7. Empty water from the EVAP canister filter.
- 8. Re-install the EVAP canister filter.
- 9. Re-install the rear bumper fascia.
  - Refer to the ESM, section EXT-Exterior, for installation information.

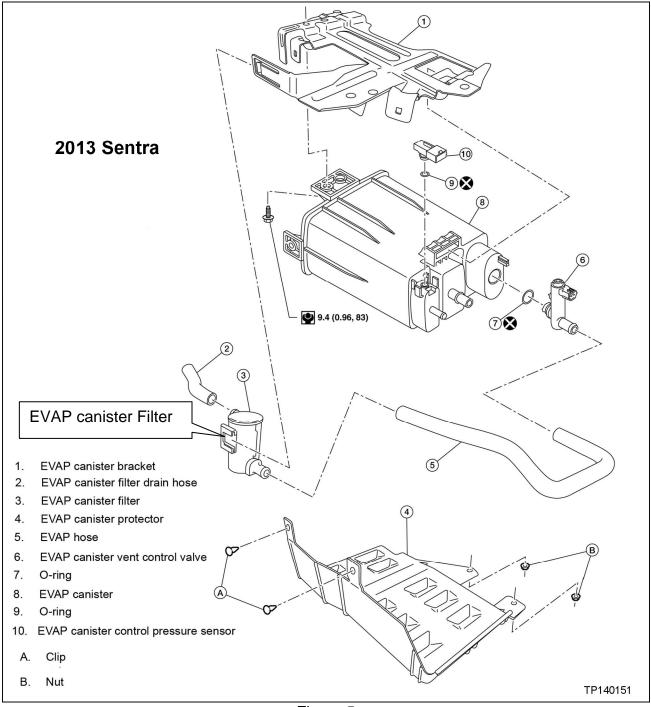


Figure 5

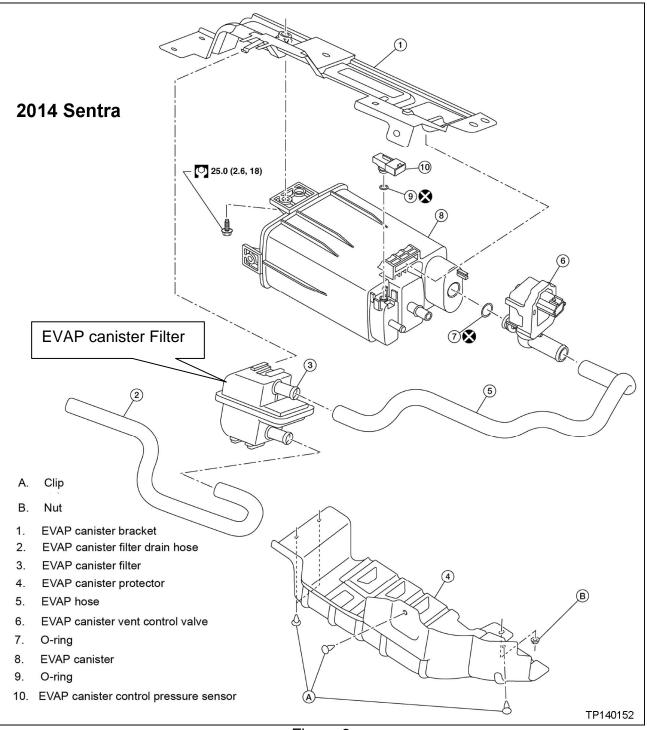


Figure 6

#### **CLAIMS INFORMATION**

#### Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Reposition Vent For EVAP	(1)	FX46AA	ZE	32	0.5 hrs.

(1) Refer to the electronic parts catalog (FAST or equivalent) and use the applicable Box Drain-Canister (18794 – XXXXX) part number as the Primary Failed Part (PFP).

**NOTE:** The above op-code is to be used only once per applied vehicle. Check the vehicle service history before submitting a claim for this op-code.