



SERVICE BULLETIN

Classification: BT14-014	Reference: NTB14-047	Date: May 22, 2014
-----------------------------	-------------------------	-----------------------

2014 ROGUE; FRONT PASSENGER DOOR POWER WINDOW SWITCH FINISHER LOOSE FIT

APPLIED VEHICLE: 2014 Rogue (T32)

IF YOU CONFIRM:

The “front door power window and door lock/unlock switch (RH) finisher” (switch finisher) has a loose fit, causing an excessive gap. See Figure 1.



Figure 1

ACTION:

1. Remove the passenger front door finisher (door finisher).
 - Refer to the Electronic Service Manual (ESM), section **INT-Interior**, for removal procedure.
2. Install a foam block where shown in **SERVICE PROCEDURE**.
 - Use the foam block listed in **PARTS INFORMATION**.
3. Install the door finisher with a new switch finisher listed in **PARTS INFORMATION**.
 - Refer to the ESM, section **INT-Interior**, for installation procedure.

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **SERVICE PROCEDURE** as it contains information that is essential to successfully completing this repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

1. Remove the passenger front door finisher.
 - Refer to the ESM, section **INT-Interior**, for removal procedure.
 - Perform all repairs in a clean working environment.
2. Install a foam block (see **PARTS INFORMATION**).
 - a. Clean the area with rubbing alcohol or other suitable cleaner before installing the foam block.
 - b. Remove the adhesive backing, and then apply the foam block where shown in Figure 2.
 - Press firmly, making sure the foam block adheres to the door finisher.

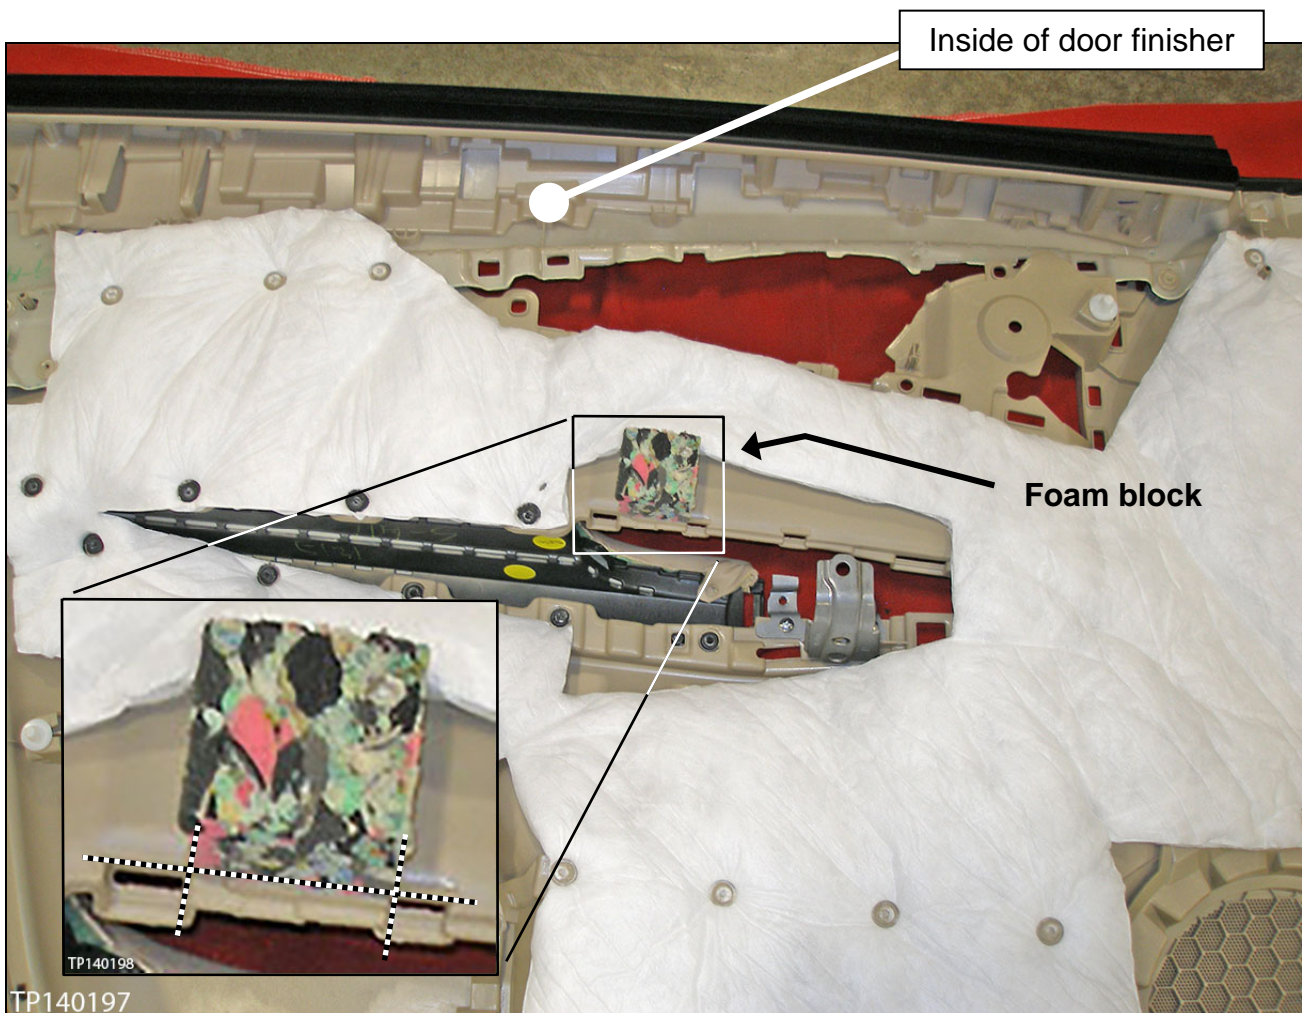


Figure 2

3. Pull the white insulation over the foam block (see Figure 3).



Figure 3

4. Replace the switch finisher with the one listed in **PARTS INFORMATION**.
 - a. Unclip the switch finisher from the “front door power window and door lock/unlock switch” (door switch). See Figure 4.
 - b. Snap the new switch finisher to the existing door switch.

NOTE: Make sure all four (4) switch finisher tabs are fully snapped onto the door switch.

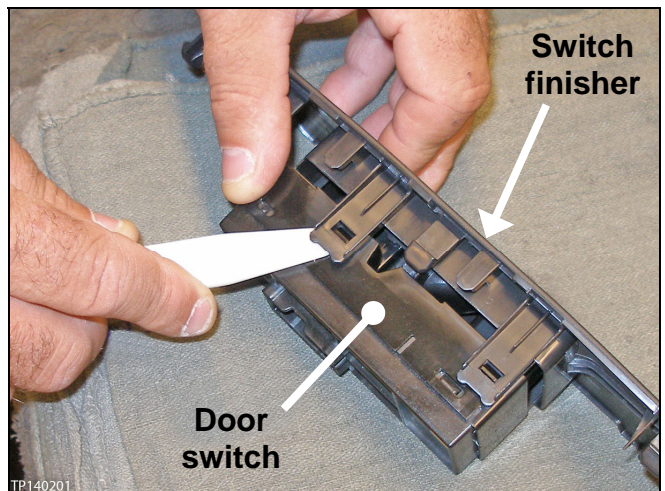


Figure 4

5. Install the door finisher.
 - Refer to the ESM, section **INT-Interior**, for installation procedure.
 - To ensure switch finisher retention: It is important the switch finisher's tab is located in the correct position (Figure 5) before installing the door pull handle and bracket.

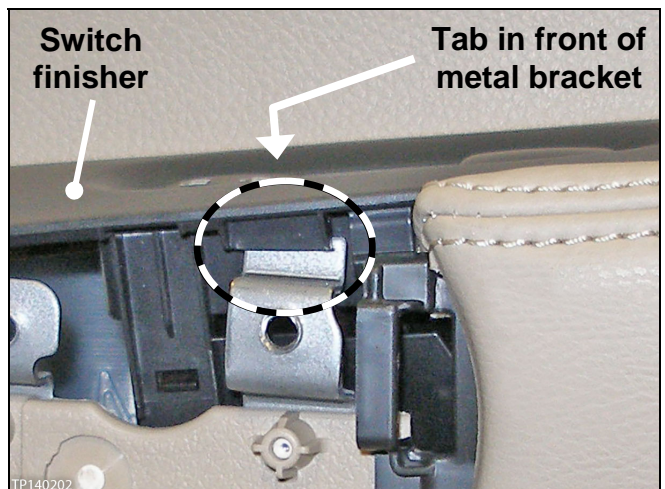


Figure 5

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
SPACER-HEADLINING (foam block)	73982-9E000 *	1
FINISHER-POWER WINDOW SWITCH, FRONT RH (switch finisher)	80960-4BA1A	1

* Foam block is located in the Squeak & Rattle Repair Kit and can be ordered through your local PDC.

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL power window switch finisher	(1)	UH45AA	ZA	45	(1)

- (1) Reference FAST and use the applicable Switch Finisher part number (80960-XXXXX) as the Primary Failed Part (PFP).
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated flat rate time.



Foam Block

