

Classification:

PD14-001

Reference:

ITB14-029

COPYRIGHT© NISSAN NORTH AMERICA, INC.

Date:

July 2, 2014

2014 Q50; RATTLE NOISE DURING ACCELERATION FROM PROPELLER SHAFT CENTER BEARING

APPLIED VEHICLES: 2014 Q50 (V37) 2WD only

NOTE: Does not apply to Q50 Hybrid.

APPLIED VIN / DATE Built before JN1BV7AP(*)EM 676992 / August 1, 2013

IF YOU CONFIRM

Using “chassis ear”, a rattle noise coming from the rear propeller shaft center bearing under the following conditions:

- Light to moderate acceleration
and
- Between 2,000 and 2,800 rpm

NOTE: The noise may sound like a slight exhaust heat shield rattle.

ACTION

Replace the rear propeller shaft with the new one (new style) listed in the Parts Information.

- Refer to the Electronic Service Manual (ESM), Section DLN-Driveline, for replacement information.

NOTE: Photos of the “old style” and “new style” rear propeller shafts are on the next page.


IMPORTANT: The purpose of ACTION (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire SERVICE PROCEDURE as it contains information that is essential to successfully completing this repair.

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

Old Style



New Style

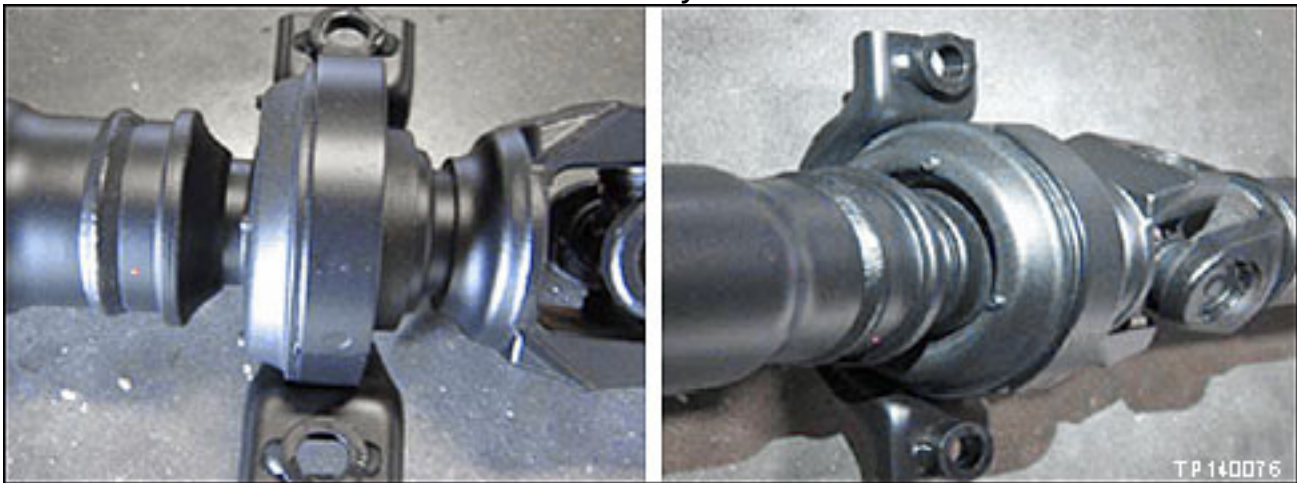

PARTS INFORMATION

DESCRIPTION	PART Number	QUANTITY
Propeller Shaft Assembly (Rear Propeller Shaft)	37000-4GB1A	1

CLAIMS INFORMATION

Submit a Primary Part (PFP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL PROPELLER SHAFT	(1)	LA10AA	ZN	32	(2)

(1) Refer to the electronic parts catalog (FAST or equivalent) and use the Propeller Shaft Assembly (37000-xxxxx) part number as the Primary Failed Part (PFP).

(2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated flat rate time.