

SERVICE BULLETIN					
Classification:	Reference:	Date:			
WT14-009	NTB14-119	December 19, 2014			

# 2013 - 2014 FRONTIER; TPMS LIGHT FLASHING AND DTC C1710 AND/OR C1711 STORED

APPLIED VEHICLE: 2013 - 2014 Frontier (D40) with non-NAVI color monitor audio unit

#### IF YOU CONFIRM:

ALL of the following conditions apply:

- The customer describes the TPMS warning lamp flashes intermittently
- One or both of the following TPMS DTCs are stored as "past":
  - > C1710: [ NO-DATA]-RR
  - > C1711: [ NO-DATA]-RL
- The vehicle's audio unit is non-NAVI equipped (no MAP button) but has a color monitor
  - This issue does not apply to vehicles with monochrome monitor audio units
  - This issue does not apply to vehicles with NAVI equipped audio units
- The transmitter(s) (TPMS sensor or sensor) related to the stored DTC(s) responds/tests as a good part with the hand held service tool Signal Tech II
- No electronic devices are plugged into any power ports such as: cell phone chargers, power inverters, etc.

#### **ACTION:**

- 1. Replace all four (4) TPMS sensors with the one listed in the **PARTS INFORMATION** section of this bulletin.
  - Refer to the ESM, section WT- Road Wheels & Tires, for replacement information.
    NOTE: Tire balancing is part of the TPMS sensor replacement procedure and is included in the Warranty Flat Rate Time (FRT).
- 2. Erase TPMS DTCs, and then test drive the vehicle to verify repairs are complete.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

## **PARTS INFORMATION**

DESCRIPTION	P/N	QTY
SEN UNIT – TIRE PRESSURE (TPMS sensor)	40700-3AN0C	4

### **CLAIMS INFORMATION**

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Rpl Tire Pressure Sensor - 1	(1)	PW24AA	ZE	32	(2)
Rpl Additional Sensor – 3	(1)	PW241A	ZE	32	(2)

- (1) Refer to the electronic parts catalog (FAST) and use the Tire Pressure Sensor part number (40700-\*\*\*\*\*) as the Primary Failed Part.
- (2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.

2/2 NTB14-119