

SS 468968 TBB Warning Lights Cracking

C2 Units Built 2011-2013

This Service Solution does not imply any special warranty coverage. Standard warranty guidelines and coverage apply. This Service Solution is provided to assist Dealers/ Customers in resolving issue cracking around the fasteners. TBB started using in correct fasteners 1/3/2011 the TBB 175020 which was a #10 Pan head Screw #10 thread.

Solution: We did a red line drawing (000659) for temporary use to go to a #8 Pan Head with #10 thread (69003165). This started with unit 1463233. However this was not a stainless steel screw. The first unit that took the stainless steel screw 189053 (#8 Pan Head Screw with #10 thread) with plastisol under head was 1464521. Refer to diagram 152269 Rev D