

TECHNICAL BULLETIN
LTB00661NAS1
22 OCT 2014



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-10

Third Row Seat Will Not Fold Or 'Sticks' In Operation

AFFECTED VEHICLE RANGE:

LR3 (LA)

Model Year: 2005-2009 **With:** 7 Seats
VIN: 5A000256-9A500451

LR4 (LA)

Model Year: 2010 Onwards **With:** 7 Seats
VIN: AA510178 Onwards

MARKETS:

NAS

CONDITION SUMMARY:

Situation: On vehicles fitted with third row seating / 7 seats, the left-hand and/or right-hand third row seat may be difficult to operate (does not fold or 'sticks' when operating).

Cause: This may be caused by the seat operating lever being out of alignment.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

No Parts Required

TOOLS:

No Tools Required

WARRANTY:


 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIX to obtain the latest repair time.

 **NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Stowage latch - Occasional rear seat - Rectification	78.85.89.56	0.2	42	HTD500270

 **NOTE:** Normal Warranty procedures apply.

SERVICE INSTRUCTION:


1.  **NOTE:** Right-hand seat shown; left-hand seat similar.

Using a suitable tool, lever the right-hand third row seat latch and release the seat.

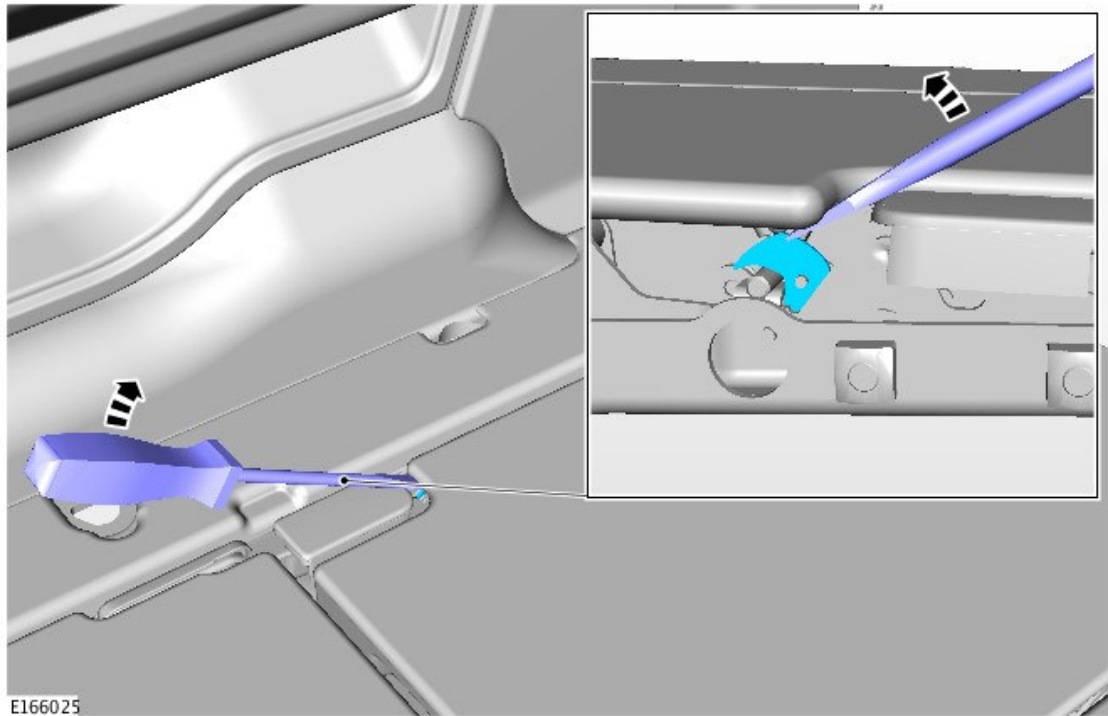

2. Inspect the linkage.

- Using a suitable tool, reposition the linkage to one side as shown.

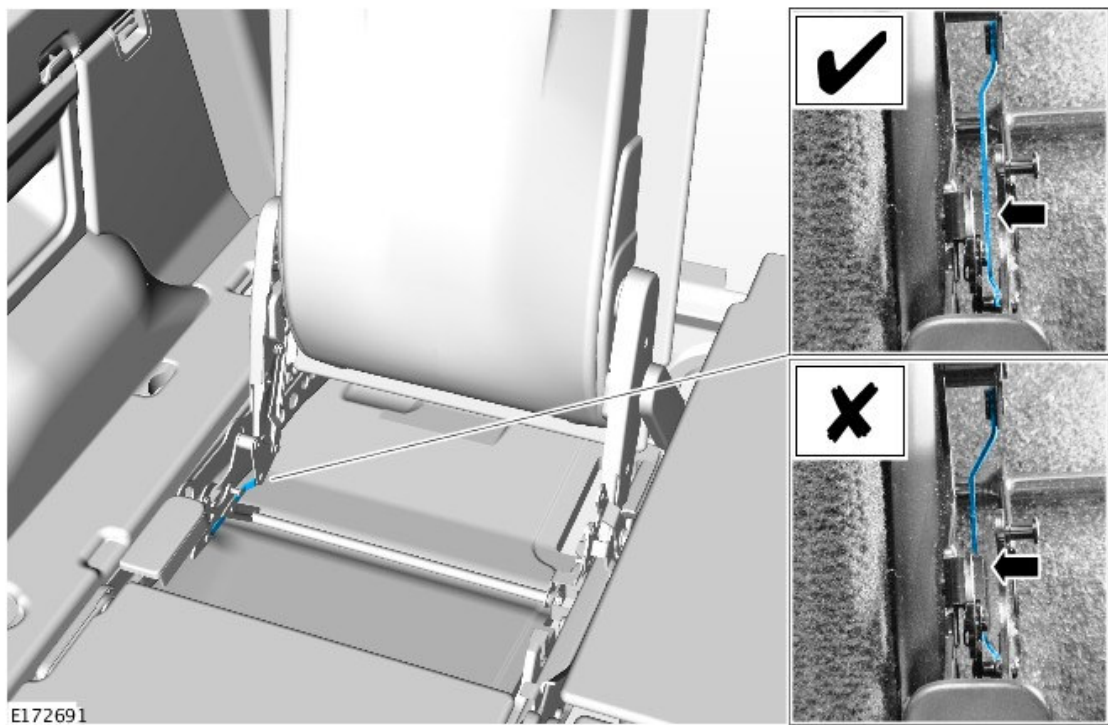

3. Check the operation of the right-hand third row seat.

4. Repeat steps 1-3 to the left-hand third row seat.