

# Technical Service Bulletin



## 37 ATF pan leaks

37 14 31 2013002/5 June 3, 2014. Supersedes Technical Service Bulletin Group 37 number 11-19 dated January 31, 2011 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2000 - 2011	All	With Automatic Transmission 01V, 09L, 0B6, or 0BK
A4, S4 Cabriolet	2003 - 2009	All	With Automatic Transmission 01V, 09L, 0B6, or 0BK
A6, S6, RS6	2000 - 2011	All	With Automatic Transmission 01V, 01L, 09E, or 09L
A8, A8L, S8	2000 - 2010	All	With Automatic Transmission 01L, 09E, or 09L
A5, S5	2008 - 2011	All	With Automatic Transmission 0B6 or 0BK
A5, S5 Cabriolet	2010 - 2011	All	With Automatic Transmission 0B5, 0B6, or 0BK
Q5	2010 - 2011	All	With Automatic Transmission 0B6 or 0BK
S4 Sedan	2004 - 2009	All	With Automatic Transmission 09L

## Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised header data (Removed 0B5 transmission vehicles)
4	1/31/2011	Revised header data Revised <i>Production Solution and Warranty</i>
3	12/16/2008	Revised title (Added Repair Group)

Automatic transmission fluid is leaking at the sump pan gasket.

## Technical Background

As the sump pan gasket settles, the torque of the bolts decreases and the seal may leak.

## Production Solution

- For transmissions 01V and 01L, there is no change.
- For transmissions 09E and 09L, a rubber metal sump pan seal in production from the following VINs:
  - 8E\_6A177000 (A4 with 09L transmission)
  - 4F\_6N121750 (A6 with 09L transmission)
  - 4E\_6N016460 (A8 with 09L transmission)
  - 4F\_7N036440 (A6 with 09E transmission)
  - 4E\_7N005290 (A8 with 09E transmission)
- For 0B6 and 0BK transmissions, a rubber metal sump pan seal in production from introduction of the transmissions.

## Service

1. Tighten the transmission sump pan bolts to the specified torque. Refer to repair manual for specific model.
2. Clean the sump pan and the transmission housing with brake cleaner spray.
3. Test drive the vehicle and inspect the sump pan gasket for leaks. A moist seal is normal.

# Technical Service Bulletin



## Warranty

When procedure applies to vehicles under warranty, use the following:

<b>Claim Type:</b>	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
<b>Service Number:</b>	3756		
<b>Damage Code:</b>	0050		
<b>Labor Operations:</b>	Torque transmission pan bolts and clean	3756 1399	40 TU
<b>Diagnostic Time:</b>	GFF – Checking and clearing fault codes included in existing labor operations	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2013002/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

All parts and service references provided in this TSB (2013002) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.