

Update Prior to Sale Notice UPS0114: Door Sill Applique - Update

SERVICE BULLETIN

18-JUN-14

No.: 6-225NAS
[issue 2]

Section: GENERAL
INFORMATION

Market: CAN / USA

CHANGES ARE LIMITED TO THE EXTENSION OF THE EXPIRY DATE

DESCRIPTION

An issue has been identified on a limited number of 2014 model year Jaguar F-TYPE (X152) vehicles within the listed VIN range where paint is not adhering to the rear panels and the paint is peeling where the sill meets the rear quarter.

AFFECTED VEHICLES

The VIN range of affected vehicles is K00001-K08070.

WORKSHOP PROCEDURES

Retailers are required to check DDW to ensure that the vehicle is affected by this program prior to undertaking any rework action. Retailers are required to **HOLD** all affected vehicles in the above VIN range that are in their control and refrain from releasing the vehicles for new or used vehicle sale pending completion of the rework action.

Refer to Technical Bulletin UPS0114-04bNAS: *Update Prior to Sale: Door Sill Applique*, for detailed repair instructions.

PARTS

NOTE: * when ordering parts, order only the expected percentage demand of parts identified

NOTE: ** an allowance equivalent of approximately \$1.00 (£0.60) has been provided to cover the cost of two (2) foam pads; claim using Sundry Code 'ZZZ001'.

NOTE: *** an allowance equivalent of approximately \$78.00 (£47.00) has been provided to cover the cost of paint and lacquer; claim using Sundry Code 'ZZZ666'.

NOTE: Nitto EPT sealer EE-1010 3mm foam pad to be sourced from the Squeaks & Rattle kit; refer to Technical Bulletin JTB00231NAS and Service Bulletin 1-248NAS for more information and how to replenish the items in the Squeaks & Rattles Kit when necessary.

DESCRIPTION	PART No. / SUNDRY CODE	QTY. / VALUE	EXPECTED % of VEHICLES REQUIRING PARTS*
Cable Tie	XR818697	2	100
Mounting Bracket - Right-Side	T2R3970	1	10
Mounting Bracket - Left-Side	T2R3971	1	10
Body Side Moulding - Right-Side	T2R10391	1	10
Body Side Moulding - Left-Side	T2R10392	1	10
Foam Pad**	ZZZ001	\$1.00	100
Paint and lacquer***	ZZZ666	\$78.00	10

TOOLS

Refer to Workshop Manual for any required tools

WARRANTY

NOTE: Check DDW to ensure that the vehicle is affected by this program prior to undertaking any rework action. Repair procedures are under constant review, and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Refer to TOPlx to obtain the latest repair time. At the time of confirming a booking for vehicle repair, ensure that all outstanding Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting Program Code 'K214', Option Code 'X', and the relevant parts and labor. The drive in / drive out allowance may only be claimed if the vehicle is brought into the workshop for this action alone to be undertaken.

This program is valid for a limited time only. Warranty claims with a repair date prior to the **7 February 2015** closure date must be submitted for payment within 30 calendar days of completion of the repair.

DESCRIPTION	SRO	TIME (HOURS)
Remove, inspect rocker panels both sides, modify brackets	76.96.22	1.7
Remove, inspect rocker panels both sides, modify bracket 1 side, replace and modify bracket 1 side	76.96.22	1.7
Remove, inspect rocker panels both sides, replace both brackets and modify	76.96.22	1.7
Remove/replace rocker panel, modify bracket, re-spray - one side	76.96.23	2.3
Remove, inspect rocker panels both sides, modify bracket both sides, respray rocker panels both sides	76.96.23	2.3
Remove, inspect rocker panels both sides, modify bracket 1 side, replace and modify bracket 1 side, respray rocker panel 1 side	76.96.23	2.3
Remove, inspect rocker panels both sides, modify bracket 1 side, replace and modify bracket 1 side, respray rocker panels both sides	76.96.23	2.3
Remove, inspect rocker panels both sides, replace and modify bracket both sides, respray rocker panel 1 side	76.96.23	2.3
Remove, inspect rocker panels both sides, replace and modify bracket both sides, respray rocker panels both sides	76.96.23	2.3
Remove, inspect rocker panels both sides, modify bracket both sides, respray rocker panel 1 side, replace rocker panel 1 side	76.96.24	3.7
Remove, inspect rocker panels both sides, modify bracket 1 side, replace and modify bracket 1 side, respray rocker panel 1 side, replace rocker panel 1 side	76.96.24	3.7
Remove, inspect rocker panels both sides, replace and modify bracket both sides, respray rocker panel 1 side, replace rocker panel 1 side	76.96.24	3.7
Remove, inspect rocker panels both sides, replace and modify bracket both sides, replace rocker panel both sides	76.96.25	4.4
Drive in/drive out	10.10.10	0.1

NOTE: Consumable cost of approximately \$1.00 (£0.60) has been provided to cover the cost of two (2) foam pads; claim using Sundry Code 'ZZZ001'.

NOTE: Consumable cost of approximately \$78.00 (£47.00) has been provided to cover the cost of paint and lacquer; claim using Sundry Code 'ZZZ666'. Dealers are NOT permitted to claim any additional allowance under ZZZ661 for this campaign.

Normal Warranty policies and procedures apply